

Recommended Drilling & Completion Procedure
A.F.E. No. 451
David Fasken
Maralo State No. 1-Y
Eddy County, New Mexico

16. Pressure test casing and Christmas tree to 3000 psig.
17. Run 2-3/8" tubing N-80, EUE 8RD c/w AB Modified couplings, and packer.
18. Displace fluid in well with 3% KCl water containing oxygen scavenger and corrosion inhibitor.
19. Set packer and install Christmas tree.
20. Swab fluid level to 9500' in tubing.
21. Run Gamma Ray correlation log and perforate Morrow for production.
22. Test well.
23. Stimulate as needed - acid and/or frac.
24. Clean up "load fluid" and test.
25. Run C.A.O.F.P. and pressure build up.
26. Install surface equipment.