


Operator Ray W. Smith
 Well 1-16-11 Conn A1
 Unit L Section 20 Township 23 Range 28
 API # 30-015-23351

TOPS

Plaster	~800'
Saled.	1000'
B. Salt	2240'
Delaware	2462'
Bea Spring	6052'
Wolfcamp	9285'
Penn.	10670'
Ark.	10843'
Atchafalaya	11056'
Missouri	11697'
Maple Grove	11907'

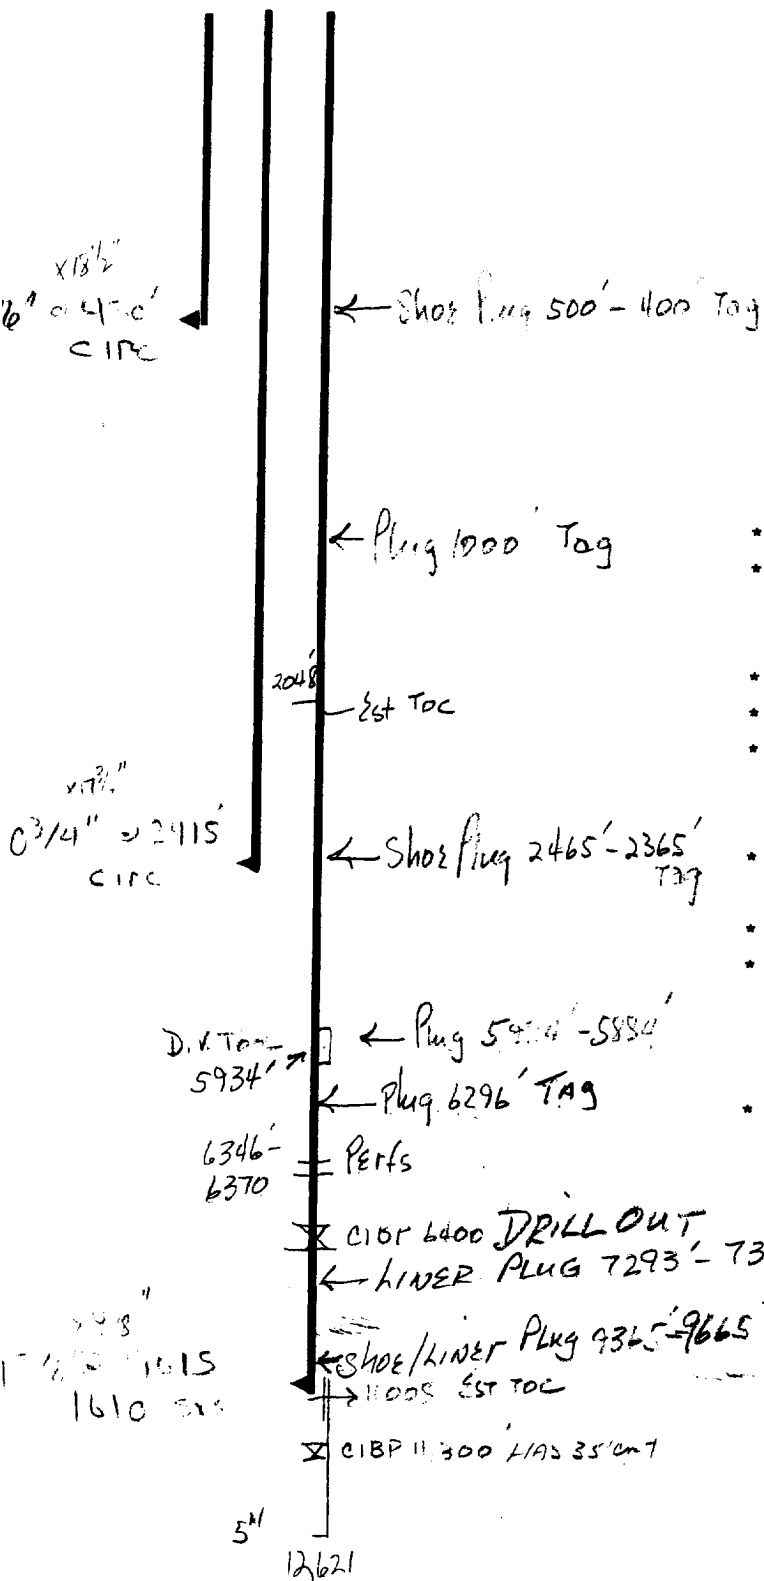

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.

1/2