

MAY 24 1982

See Instructions on Reverse Side

Posted #D-2
5-38-82
zone PFA-Held

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

GPO : 1976 O - 214-149

5. Run free pt. Cut off 5-1/2" csg @ +6100' or wherever free. Pull 5-1/2" csg. free. POOH & LD 5-1/2" csg.
6. RIH w/open ended tubing to new PRTD of +7400'. Circ. hole w/mud laden fluid.
7. Pull tbg. to +6150'. Spot 100' cmt. plug (6150-6050') half in and half out of the 5-1/2" csg. stub.
8. Pull tbg. to +4285'. Spot 100' cmt plug (4285-4185') half above and half below the top of the Bone Springs.
9. Pull tbg to +2540'. Spot 100' cmt plug (2540-2440') half in and half out of the 8-5/8" csg shoe @ 2490'.
10. Pull tbg to +404'. Spot 100' cmt plug (404-304') half in & half out of the 13-3/8" csg shoe @ 354'. POOH w/tbg.
11. Dmp ~~15~~ ¹⁵ sx cmt (~~30~~) for surface plug from 0-30'.
12. Install 4" dry hole marker (6' below ground & 4' above ground) to designate P&A location. Clear location.