


45F

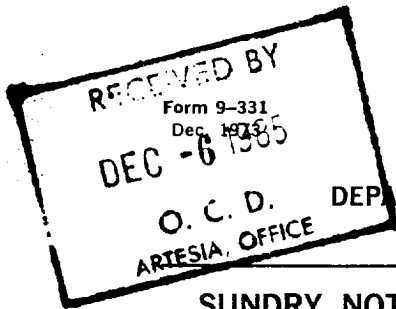

NOV 16 1982

UNITED STATES DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
NEW MEXICO

Form Approved.
Budget Bureau No. 42-R1424

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☐ well other ☐ Dry Hole
2. NAME OF OPERATOR
Cities Service Company ✓
3. ADDRESS OF OPERATOR
P.O. Box 1919, Midland, Texas 79702
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 785' FNL & 2180' FWL
AT TOP PROD. INTERVAL: Same as above
AT TOTAL DEPTH: Same as above

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

- | REQUEST FOR APPROVAL TO: | SUBSEQUENT REPORT OF: |
|---|-------------------------------------|
| TEST WATER SHUT-OFF ☐ | ☐ |
| FRACTURE TREAT ☐ | ☐ |
| SHOOT OR ACIDIZE ☐ | ☐ |
| REPAIR WELL ☐ | ☐ |
| PULL OR ALTER CASING ☐ | ☐ |
| MULTIPLE COMPLETE ☐ | ☐ |
| CHANGE ZONES ☐ | ☐ |
| ABANDON* ☐ | ☒ |
| (other) ☐ | |

5. LEASE
NM 36400
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Federal Q
9. WELL NO.
1
10. FIELD OR WILDCAT NAME
Wildcat
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec 23-T23S-R23E
12. COUNTY OR PARISH
Eddy
13. STATE
New Mexico
14. API NO.
30-015-23721
15. ELEVATIONS (SHOW DF, KDB, AND WD)
4058' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

TD 10,449' Lime and Shale, PBTD 8380'. This well was plugged and abandoned in the following manner:

1. MIRU plugging unit. Killed well. Loaded hole. RU wireline and set blanking plug in profile nipple @ 8072'. Circ hole.
2. POOH w/tbg and packer. Dumped 6 sacks cement on top of packer @ 8066'. Set CIBP on WL @ 7450'. Dumped 6 sacks cement on top of CIBP. RD wireline.
3. RIH w/tbg to 7300'. Circ hole w/mud laden fluid. POOH.
4. Ran free point. POOH.
5. RIH w/tbg to 5140'. Circ hole w/mud laden fluid. Spotted 50 sack cement plug 5140-5040' half in and half out of 5-1/2" casing stub. Circ hole w/mud laden fluid. POOH.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Elmer Startz TITLE Reg.Opr.Mgr.-Prod. DATE 11-10-82

(This space for Federal or State office use)

APPROVED BY [Signature] TITLE _____ DATE 12-5-85
CONDITIONS OF APPROVAL, IF ANY: _____

Post 20-2
4-26-82
PLA

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

GPO : 1976 O - 214-149

6. RIH and tagged cement plug @ 4930'. POOH w/tbg to 4285'. Spotted 40 sack cement plug 4285-4185'. POOH to 2540'. Spotted 50 sack cement plug 2540-2440'. POOH.
7. RIH w/tbg. Tagged cement plug at 2417'. POOH to 404'. Spotted 40 sack cement plug 404 - 304' half above and half below 13-3/8" casing shoe @ 2490'. POOH to 50'. Spotted 15 sack surface plug 50-0'. Cut off WH.
8. Installed 4" dry hole marker to designate a plugged and abandoned location. Cleared location.

Arland Cope W/MMS witnessed setting plugs.

