

9. (Cont'd) N-up wlhd and call BLM.
10. MIRU PU. TIH w/6 3/4" bit. No plug @ 65'. TIH to 320' & tag plug. POOH w/1-jt 2 7/8" tbg. Try to estab. IR. Won't take wtr. POOH w/tools and LD. TIH w/ 2 7/8" tbg to 320'. Pmp 178-sx cmt. Circ out 10 3/4" csg. POOH w/ 2 7/8" tbg. Pmp'd 4-sx load 10 3/4" csg. press to 500# and SDSI.
11. RIH w/ 2 7/8" tbg & tag plug @ 75' below surface. Pmp 60-sx cmt plug. POOH w/tbg & fill 10 3/4" csg back to surface w/cmt. No flow or movement on 10 3/4" csg. Wait 3 hrs & still no movement.
12. Cut off wlhd and 11 3/4" sow. Weld on dry hole marker. Plugged & abandoned on 8/4/93.