

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

2158
Op

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87501

OCT - 5 1992

O. C. D.

ARTESIA OFFICE

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☒

GAS
WELL ☐

OTHER

2. Name of Operator

RB Operating Company

3. Address of Operator

601 N. Marienfeld, Ste 102, Midland, TX 79701

4. Well Location

Unit Letter KN : 554 Feet From The South Line and 1874 Feet From The West Line

Section

23

Township

23S

Range

28E

NMPM

Eddy

County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3004.3 GR

WELL API NO.

30-015-23833

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

19371

7. Lease Name or Unit Agreement Name

BRANTLEY COMM.

8. Well No.

1

9. Pool name or Wildcat

E. Loving (Delaware)

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☒

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

SEE ATTACHED PROCEDURE

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Tim Goudeau

TITLE

Operations Manager

DATE 10-1-92

TYPE OR PRINT NAME

Tim Goudeau

TELEPHONE NO. 915-682-0095

(This space for State Use)

ORIGINAL SIGNED BY

MIKE WILLIAMS

SUPERVISOR, DISTRICT II

APPROVED BY

TITLE

DATE

OCT 7 1992

CONDITIONS OF APPROVAL, IF ANY:

RECOMPLETION PROCEDURE

BRANTLEY COMM #1

1. MI & RU PU. NU BOP. TOH W/ TUBING AND BHA.
2. RU WIRELINE AND TIH W/ GAUGE RING AND JUNK BASKET TO 6130'. SET 5-1/2" CIBP AT 6100'. LOAD CASING AND TEST TO 700#. TIH W/ 4" CASING GUN AND PERFORATE AT 5824'-5840' AND 5857-5878' W. 2 SPF (TOTAL OF 78 HOLES). RIG DOWN WIRELINE.
3. PICK UP 2-7/8" n-80 WORK STRING AND 5-1/2" PACKER, TRIP IN HOLE TO 5857'. TEST TUBING TO 5000# WHILE TIH. SPOT 300 GALLONS 15% NEFE ACROSS PERFS. PU PACKER TO 5720' AND REVERSE ACID. SET PACKER AND BREAK DOWN PERFS WITH ACID ON SPOT. ACIDIZE WITH 4000 GALLONS 15% NEFE DIVERTED WITH 156 RCNBS. SWAB BACK LOAD.
4. RIG UP AND FRACTURE PERFS. W/ 50,000 GALLONS BORATE AND 50,000# 20/40 SAND. FORCE CLOSE FRACTURE.
5. FLOW AND SWAB BACK LOAD UNTIL PRODUCTION CEASES.
6. UNSEAT PACKER AND TRIP OUT OF HOLE. LAY DOWN STRING. TRIP IN AND TAG PBTD. CLEANOUT IF NECESSARY. TRIP OUT W/ TUBING AND BHA. PICK UP PRODUCTION ASSEMBLY AND TRIP IN W/ 2-7/8" TUBING. PICK UP AND TRIP IN WITH PUMP AND RODS. PLACE WELL ON PRODUCTION.