

## OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-71

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	
OPERATOR	<input checked="" type="checkbox"/>

30-015-2839

RECEIVED BY

JAN 13 1984

O. C. D.

ARTESIA OFFICE

5a. Indicate Type of Lease

State ☐Fee ☒

5. State Oil &amp; Gas Lease No.

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	8. Unit Agreement Name
2. Name of Operator DINERO OPERATING COMPANY	8. Farm or Lease Name Mc Nutt
3. Address of Operator P. O. DRAWER 10505, MIDLAND, TEXAS 79702	9. Well No. 1
4. Location of Well UNIT LETTER <u>L</u> 1980 FEET FROM THE <u>South</u> LINE AND <u>630</u> FEET FROM THE <u>West</u> LINE, SECTION <u>12</u> TOWNSHIP <u>24-S</u> RANGE <u>28-E</u> NMPM.	10. Field and Pool, or Wildcat Und. Malaga Delaware
15. Elevation (Show whether DF, RT, GR, etc.) 2977.6 G.L.	12. County EDDY

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐PLUG AND ABANDON ☐REMEDIAL WORK ☐ALTERING CASING ☐TEMPORARILY ABANDON ☐COMMENCE DRILLING OPS. ☐PLUG AND ABANDONMENT ☒PULL OR ALTER CASING ☐CHANGE PLANS ☐CASING TEST AND CEMENT JOBS ☐OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

1. Pull rods and pump.
2. Run in hole with tubing to 5050'. Set plug (25 sacks) on top of CIPB at 5050'. Pull out of hole with tubing.
3. Circ. hole with mud.
4. Run in hole with CIBP on tubing. Set CIBP at 4600'.
5. Run in hole with tubing. Set plug (25 sacks) from 4600' to 4250'.
6. Set plug (25 sacks) at top of Delaware (2430') from 2600' to 2250'. (This also covers 8 5/8" shoe at 2500').
7. Pull approx. 1820' of 4 1/2" casing from hole.
8. Set plug (25 sacks) from 1770' to 1870'. WOC for 4 hours. Tag TOC.
9. Set plug (35 sacks) from 450' to 350'. (This covers shoe of 13 3/8" casing at 400').
10. Set marker in 10 sacks cement.

Post IL  
1-20-84  
17+

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jim Beigne TITLE Engineer for DINERODATE Jan. 11, 1984APPROVED BY Randy Brooks TITLE GeologistDATE 10-10-84

CONDITIONS OF APPROVAL, IF ANY: