

- 10-30-84 (Day 11) PBTD 8530'
RIH w/tbg. Tagged plug @ 8620'. Plug too low. RU pump. Mix & pump 4 transport loads of 10# brine mud. Spot 35 sx Class H cmt @ 8620'. Pull 25 stands tbg & SDFN.
- 10-31-84 (Day 12) PBTD 8530'
Open well. RIH w/2 3/8" tbg. Tag plug @ 8580'. Pull up to 7600'. Load hole w/10# mud. Spot 55 sx Cl H cmt. Pull up to 6250'. Load hole w/mud. Spot 55 sx Cl H cmt. POOH w/tbg. ND BOP & wellhead. SDFN.
- 11-1-84 (Day 13) PBTD 8530'
Crew to location. Clean out cellar. Set csg jacks. Weld on 9 5/8" pull nipple. PU to 385 M#. Slips did not move. Consult w/BLM. RU WL. GIH and cut 9 5/8" csg @ 2705'. POOH. RD WL, pull up 1 jt and remove csg slips. RD jacks. SD. Crew to Carlsbad.
- 11-2-84 (Day 14) PBTD 8530'
Crew to location. RU csg tongs. POOH w/76 jts of 9 5/8" csg for a total of 2688'. RD csg pulling equip. RU to run tbg. SD. Crew to Carlsbad.
- 11-3-84 (Day 15) PBTD 2650'
Crew to location. NU WH and BOP. GIH w/2 3/8" tbg to 2765'. RU pump, mix and circ hole w/10 ppg mud. Spot 75 sx Cl C cmt w/2% CaCl @ 2765'. Pull 30 jts. WOC 3 hrs. GIH and tag plug @ 2650'. Pull and lay down 20 jts. SI. Crew to Carlsbad.
- 11-4-84 (Day 16) PBTD Surface
Crew to location. Pull tbg to 450'. RU pump, mix and load hole w/10 ppg mud. Spot 75 sx Cl C cmt @ 4501'. Pull tbg to 60'. Spot 25 sx Cl C cmt. POOH w/tbg. RD tbg tongs. ND BOP. Cleaned and dug out cellar. Cellar had cmt floor. SD. Road crew to Odessa.
- 11-5-84 SD for Sunday.
- 11-6-84 (Day 17) PBTD Surface
Start breaking out cmt around conductor pipe to cap well and install dry hole marker.
-
- 11-7-84 (Day 10) PBTD Surface
Finished breaking out cmt in cellar. Cut of WH. Weld plate on csg & install dry hole marker. Well P&A 11-6-84. FINAL REPORT.