

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved
Budget Bureau No. 1004-013
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐

RECEIVED

2. NAME OF OPERATOR

Chevron U.S.A. Inc. ✓

3. ADDRESS OF OPERATOR

P.O. Box 670, Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

ARTESIA, OFFICE

Unit K, 1830 FSL and 1650 FWL, Sec.20,T24S,R26E

14. PERMIT NO.

15. ELEVATIONS (Show whether OF, RT, CR, etc.)

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☒

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

Work performed: 1-25-/1-26-89 TD: 11,500 PB: 11,450

Run guage ring to 10,319. Run F plug, set in profile nipple at 10,319. RU Howco load tbg w/ KCL, tst tbg to 6400 to surf. press ok. Rel press. Tst to 900psi, ok. Swb tbg down to 8000'±. Pull equalizing plug, run in hole w/ ret. tool, pull blanking plug. Install tree saver, press ann to 500psi. Test lines, acdz perfs 10,366 - 11,376 w/6000 gallons modified morflo 10% w/96 balls. Shut well in for 1 hr. Open up, start flow back. Close well in, hook up test unit. RU swab. Swabbing f/10,300'. Rec. 7bbbls per hr. 4 runs per hr. RD swb. Put thru tst unit. Turn over to production dept.

For Record Only

18. I hereby certify that the foregoing is true and correct

SIGNED L. K. Elmore

TITLE Technical Assistant

DATE 1-31-89

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE