			4 - 2 - F	·승규는 한 가락을 주말 같은 것은 가락을 주말하는 것이 같이		
						C15
Form 3160-5 (June 1990)		ED STATES		ે જેવા તેવું છે.		PPROVED
June 1990)		OF THE INTERI		:	•	i No. 1004–0135 arch 31, 1993
	BUREAU OF L	AND MANAGEMI	ENT		5. Lease Designation	and Serial No
	SUNDRY NOTICES A	ND REPORTS O	NWELLS		NM 16331	
Do not use this fo	rm for proposals to drill			reservoir	6. If Indian, Allottee	or Tribe Name
U:	se "APPLICATION FOR	PERMIT-" for su	ch proposals			
	SUBMIT I	N TRIPLICATE			7. If Unit or CA, Ag	greement Designation
1 Type of Well Oil Gas Well Well	Other			8	. Well Name and No	
2. Name of Operator	/				imarron /RB/	Federal Gas Com#1
Amoco Product 3. Address and Telephone No.			,,,		API Well No.	
	-		(3	80-015-24283	
4 Location of Well (Ecologie	2 (Ran 17.182) Houston, Sec., T., R., M., or Survey Desc	TX //253-3092	(713) 596-7686		Field and Petol, or	Exploratory Area
		ription		-		Bone Springs
	FWL (Unit Ltr. L)				1. County or Parish,	State
Sec. 34, T-22-S,	R-28-E			E	ddy, NM	
	PPROPRIATE BOX(s)	TO INDICATE N	ATURE OF NOTICE	E, REPORT,	OR OTHER	DATA
TYPE OF S	UBMISSION			F ACTION		
Notice of	inten	Aba	ndonment		Change of Plans	
		XX Rect	mpletion		New Construction	
	_				F 1	cturing
XX Subsequen	t Report	Piug	ging Back		Non-Routine Fra	
XX Subsequen	t Report		ging Back ng Repair		Water Shut-Off	-
	ndonment Notice				i	ijection
—	:		ng Repair ring Casing		Water Shut-Off Conversion to Ir Dispose Water	*
Final Abar	:	Casi Alter Othe	ng Repair ring Casing r		Water Shut-Off Conversion to Ir Dispose Water (Note: Report results of in	nultiple completion on We'l
 Final Abar Describe Proposed or Comp give subsurface location MIRUSU 5-26-93 X RT POH X RIH X WL X 4- POH X RIH X WL X 7- 9450' X 35' CMT. PO 10,000# WELLHEAD W X INSTALL TREE SAW BPM. FLUSH X 70 BB 6 HR X REC 46 BLW X RD PULLING UNIT X I X 6 MIN. R SWB X IFI DWN X 3 MIN X ATT W/BLANK CPLG TO CI 	ndonment Notice	Casi Casi	ng Repair ring Casing r unent dates, including estimated of tones pertinent to this work.)* P BAILER, RIH X WL X C OM 8000 TO 5500' X POH 7632-7642 W/4 JSPF, RIH SAD TREE, R SWB X IFL 1.3) BALL SEALERS, M. PC 0 X TPC X 1300 X BLE DRY (LESS THAN 1 BBL R E X SLIGHT BLOW AFTEH C. R SWB X IFL 6100' 2 GHT BLOW X FFL 7150'. 1 UT IN WELL.	A RIH X WL X AUGE RING X AUGE RING X X WL. RIH X I X PKR X TBO SURF X SWB AX TRTP 3800 D DWN X 1 M REC). 12 HR X REACH RUN. X 5 RUNS X R I3 HR CPC 0 X CCEPTED OR G. SGD	Water Shut-Off Conversion to Ir Dispose Water (Note. Report results of n Completion or kecomplet proposed work. If we are a state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of th	NG TO 11440' LINE @ 9491' X CAP CIBP SA 8000 PSI X OK. W OUT OF TBG 800 X AIR 3-1/2 L SURF X SWB X BLED DWN PC 420. BLED NO GAS X RIH DWN X 2 MIN
Final Abar 3 Describe Proposed or Comp give subsurface location MIRUSU 5-26-93 X RT POH X RIH X WL X 4- POH X RIH X WL X 7- 9450' X 35' CMT. PO 10,000# WELLHEAD V X INSTALL TREE SAV BPM. FLUSH X 70 BB 6 HR X REC 46 BLW X RD PULLING UNIT X H X 6 MIN. R SWB X IFI DWN X 3 MIN X A'TT W/BLANK CPLG TO CI X IFL 6600' X SWB 6 H	ndonment Notice Dieted Operations (Clearly state all pe- poins and measured and true vertical of 1/2" CIBP. SET @ 11435' X of 5/8" CIBP SA 9450. R GR CO H X RIH X PERF GUN X 4" VOULD NOT TEST, REPLACI VOULD NOT TEST, REPLACI VEX X ACD W/5000 GAL X A LS X ISIP 1780 X 5 MIN X 17 SWB DRY X FFL @ SNIP 750 RU SWB UNIT. R SWB X IFL 6900' X SWB 9 HRS X REC TO FISH BALL SEALERS X HECK FOR PLUGGING. R SW RS X RE 1/2 BLW X 0 GAS X	Casi Casi	ng Repair ring Casing r unent dates, including estimated of tones pertinent to this work.)* P BAILER, RIH X WL X C OM 8000 TO 5500' X POH 7632-7642 W/4 JSPF, RIH SAD TREE, R SWB X IFL 1.3) BALL SEALERS, M. PC 0 X TPC X 1300 X BLE DRY (LESS THAN 1 BBL R E X SLIGHT BLOW AFTEH C. R SWB X IFL 6100' 2 GHT BLOW X FFL 7150'. 1 UT IN WELL.	A RIH X WL X AUGE RING X AUGE RING X X WL. RIH X I X PKR X TBO SURF X SWB AX TRTP 3800 D DWN X 1 M REC). 12 HR X REACH RUN. X 5 RUNS X R I3 HR CPC 0 X CCEPTED OR G. SGD	Water Shut-Off Conversion to Ir Dispose Water thote. Report results of Completion or kecomplet proposed work. If we characteristic of the TAG TOP 4-1/2" DUMP BAILER G X TST TBG X I HR REC 40 BLV X AVG TRTP 28 IN X R SWB X IF CPC 0 X TPC 230 56 HR CPC 9 X T EC 1/4 BLW X N TPC 200	NG TO 11440' LINE @ 9491'. X CAP CIBP SA 8000 PSI X OK. W OUT OF TBG 8000 X AIR 3-1/2 L SURF X SWB X BLED DWN PC 420. BLED NO GAS X RIH DWN X 2 MIN D
Final Abar 3 Describe Proposed or Comp give subsurface location MIRUSU 5-26-93 X RT POH X RIH X WL X 4- POH X RIH X WL X 7- 9450' X 35' CMT. PO 10,000# WELLHEAD W X INSTALL TREE SAV BPM. FLUSH X 70 BB. 6 HR X REC 46 BLW X RD PULLING UNIT X I X 6 MIN. R SWB X IFI DWN X 3 MIN X A'TT W/BLANK CPLG TO CI X IFL 6600' X SWB 6 H	ndonment Notice Dieted Operations (Clearly state all performs and measured and true vertical of 1/2" CIBP. SET @ 11435' X (5/8" CIBP SA 9450. R GR CO H X RIH X PERF GUN X 4" VOULD NOT TEST, REPLACI /ER X ACD W/5000 GAL X A LS X ISIP 1780 X 5 MIN X 17 SWB DRY X FFL @ SNIP 750 RU SWB UNIT. R SWB X IFL 6900' X SWB 9 HRS X REC TO FISH BALL SEALERS X HECK FOR PLUGGING. R SW RS X RE 1/2 BLW X 0 GAS X egoing is true and correct.	Casi Alter Othe Alter Othe Alter Correction	ng Repair ring Casing r unent dates, including estimated of tones pertunent to this work* P BAILER, RIH X WL X C OM 8000 TO 5500' X POH 7632-7642 W/4 JSPF, RIH EAD TREE, R SWB X IFL 1.3) BALL SEALERS, M. PC 0 X TPC X 1300 X BLE DRY (LESS THAN 1 BBL R E X SLIGHT BLOW AFTEH EC. R SWB X IFL 6100' 2 JHT BLOW X FFL 7150', 1 UT IN WELL.	A RIH X WL X AUGE RING X X WL. RIH X I X PKR X TBO SURF X SWB AX TRTP 3800 D DWN X 1 M EC). 12 HR X R EACH RUN. X 5 RUNS X R I 3 HR CPC 0 X CCEPTED OR G. SGD JUN 2	Water Shut-Off Conversion to Ir Dispose Water (Note: Report results of n Completion or kecomplet proposed work. If we TAG TOP 4-1/2" DUMP BAILER 3 X TST TBG X 1 HR REC 40 BLV X AVG TRTP 28 IN X R SWB X IF CPC 0 X TPC 230 56 HR CPC 9 X T EC 1/4 BLW X N TPC 200_BLED FOR RECOR	NG TO 11440' I is directionally drilled. NG TO 11440' LINE @ 9491'. X CAP CIBP SA 8000 PSI X OK. W OUT OF TBG 900 X AIR 3-1/2 L SURF X SWB OX BLED DWN PC 420. BLED NO GAS X RIH DWN X 2 MIN D GLASS
Final Abar 3 Describe Proposed or Comp give subsurface location MIRUSU 5-26-93 X RT POH X RIH X WL X 4- POH X RIH X WL X 7- 9450' X 35' CMT. PO 10,000# WELLHEAD V X INSTALL TREE SAV BPM. FLUSH X 70 BB 6 HR X REC 46 BLW X RD PULLING UNIT X H X 6 MIN. R SWB X IFI DWN X 3 MIN X A'TT W/BLANK CPLG TO CI X IFL 6600' X SWB 6 H	ndonment Notice Dieted Operations (Clearly state all performs and measured and true vertical of 1/2" CIBP. SET @ 11435' X of 5/8" CIBP SA 9450. R GR CO H X RIH X PERF GUN X 4" VOULD NOT TEST, REPLACI /ER X ACD W/5000 GAL X A LS X ISIP 1780 X 5 MIN X 17 SWB DRY X FFL @ SNIP 750 RU SWB UNIT. R SWB X IFL 6900' X SWB 9 HRS X REC TO FISH BALL SEALERS X HECK FOR PLUGGING. R SW RS X RE 1/2 BLW X 0 GAS X egoing is true and correct. M. M. M	Casi Alter Othe Priment details, and give peri- tepths for all markers and 2 DH X PTG. LAY DOW CAP 35' CMT X DUMI DRRELATION LOG FR X PERF 7610-7620 X E W/10,000# WELLHH ADDITIVES X 60 (7/8" '10 X 15 MIN.13 HR CI 64'. . 75' X 1 RUN X SWB I 18 BLW CONDENSATI 3 RUNS X NONE RE /B X REC 0 BLW X LIC RDSU 6-8-93 AND SH	ng Repair ring Casing r unent dates, including estimated of tones pertunent to this work* P BAILER, RIH X WL X C OM 8000 TO 5500' X POH 7632-7642 W/4 JSPF, RIH EAD TREE, R SWB X IFL 1.3) BALL SEALERS, M. PC 0 X TPC X 1300 X BLE DRY (LESS THAN 1 BBL R E X SLIGHT BLOW AFTEH EC. R SWB X IFL 6100' 2 JHT BLOW X FFL 7150', 1 UT IN WELL.	A RIH X WL X AUGE RING X X WL. RIH X I X PKR X TBO SURF X SWB AX TRTP 3800 D DWN X 1 M EC). 12 HR X R EACH RUN. X 5 RUNS X R I 3 HR CPC 0 X CCEPTED OR G. SGD JUN 2	Water Shut-Off Conversion to Ir Dispose Water (Note. Report results of n Completion or kecomplet proposed work. If we are a state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of th	NG TO 11440' I Is directionally drilled. NG TO 11440' LINE @ 9491'. X CAP CIBP SA 8000 PSI X OK. W OUT OF TBG 900 X AIR 3-1/2 L SURF X SWB O X BLED DWN PC 420. BLED NO GAS X RIH DWN X 2 MIN D GIASS
Final Abar 3 Describe Proposed or Comp give subsurface location MIRUSU 5-26-93 X RT POH X RIH X WL X 4- POH X RIH X WL X 7- 9450' X 35' CMT. PO 10,000# WELLHEAD V X INSTALL TREE SAV BPM. FLUSH X 70 BB 6 HR X REC 46 BLW X RD PULLING UNIT X I X 6 MIN. R SWB X IFI DWN X 3 MIN X A'TT W/BLANK CPLG TO CI X IFL 6600' X SWB 6 H	ndonment Notice Dieted Operations (Clearly state all performs and measured and true vertical of 1/2" CIBP. SET @ 11435' X of 5/8" CIBP SA 9450. R GR CO H X RIH X PERF GUN X 4" VOULD NOT TEST, REPLACI /ER X ACD W/5000 GAL X A LS X ISIP 1780 X 5 MIN X 17 SWB DRY X FFL @ SNIP 750 RU SWB UNIT. R SWB X IFL 6900' X SWB 9 HRS X REC TO FISH BALL SEALERS X HECK FOR PLUGGING. R SW RS X RE 1/2 BLW X 0 GAS X egoing is true and correct. M. M. M	Casi Alter Othe Prtinent details, and give peri- tepths for all markers and a DH X PTG. LAY DOW CAP 35' CMT X DUMI DRRELATION LOG FR X PERF 7610-7620 X E W/10,000# WELLHH ADDITIVES X 60 (7/8" '10 X 15 MIN.13 HR CI 64'. . 75' X 1 RUN X SWB I 18 BLW CONDENSATI 3 RUNS X NONE RE /B X REC 0 BLW X LIC RDSU 6-8-93 AND SH	ng Repair ring Casing r unent dates, including estimated of tones pertunent to this work* P BAILER, RIH X WL X C OM 8000 TO 5500' X POH 7632-7642 W/4 JSPF, RIH EAD TREE, R SWB X IFL 1.3) BALL SEALERS, M. PC 0 X TPC X 1300 X BLE DRY (LESS THAN 1 BBL R E X SLIGHT BLOW AFTEH EC. R SWB X IFL 6100' 2 JHT BLOW X FFL 7150', 1 UT IN WELL.	A RIH X WL X AUGE RING X X WL. RIH X I X PKR X TBO SURF X SWB AX TRTP 3800 D DWN X 1 M EC). 12 HR X R EACH RUN. X 5 RUNS X R I 3 HR CPC 0 X CCEPTED OR G. SGD JUN 2	Water Shut-Off Conversion to Ir Dispose Water (hote. Report results of n Completion or kecomplet proposed work. If we can be a constructed work. If we can be a constructed work. If we can be a const	NG TO 11440' I Is directionally drilled. NG TO 11440' LINE @ 9491'. X CAP CIBP SA 8000 PSI X OK. W OUT OF TBG 900 X AIR 3-1/2 L SURF X SWB O X BLED DWN PC 420. BLED NO GAS X RIH DWN X 2 MIN D GIASS
Final Abar 3 Describe Proposed or Comp give subsurface location MIRUSU 5-26-93 X RT POH X RIH X WL X 4- POH X RIH X WL X 7- 9450' X 35' CMT. PO 10,000# WELLHEAD W X INSTALL TREE SAV BPM. FLUSH X 70 BB. 6 HR X REC 46 BLW X RD PULLING UNIT X I X 6 MIN. R SWB X IFI DWN X 3 MIN X ATT W/BLANK CPLG TO CI X IFL 6600' X SWB 6 H 4. I hereby certify that the for Signed Light Matter for Signed Comparison of Signed Compa	Adonment Notice Dieted Operations (Clearly state all performs and measured and true vertical of 1/2" CIBP. SET @ 11435' X (5/8" CIBP SA 9450. R GR CO H X RIH X PERF GUN X 4" VOULD NOT TEST, REPLACE VER X ACD W/5000 GAL X A LS X ISIP 1780 X 5 MIN X 17 SWB DRY X FFL @ SNIP 750 RU SWB UNIT. R SWB X IFL 6900' X SWB 9 HRS X REC TO FISH BALL SEALERS X HECK FOR PLUGGING. R SW RS X RE 1/2 BLW X 0 GAS X Contractions of the second correct Mathematical State office use)	Casi Alter Othe Alter Othe Alter Correction	ng Repair ring Casing r unent dates, including estimated of tones pertunent to this work* P BAILER, RIH X WL X C OM 8000 TO 5500' X POH 7632-7642 W/4 JSPF, RIH EAD TREE, R SWB X IFL 1.3) BALL SEALERS, M. PC 0 X TPC X 1300 X BLE DRY (LESS THAN 1 BBL R E X SLIGHT BLOW AFTEH EC. R SWB X IFL 6100' 2 JHT BLOW X FFL 7150', 1 UT IN WELL.	A RIH X WL X AUGE RING X X WL. RIH X I X PKR X TBO SURF X SWB AX TRTP 3800 D DWN X 1 M EC). 12 HR X R EACH RUN. X 5 RUNS X R I 3 HR CPC 0 X CCEPTED OR G. SGD JUN 2	Water Shut-Off Conversion to Ir Dispose Water (Note: Report results of n Completion or kecomplet proposed work. If we TAG TOP 4-1/2" DUMP BAILER 3 X TST TBG X 1 HR REC 40 BLV X AVG TRTP 28 IN X R SWB X IF CPC 0 X TPC 230 56 HR CPC 9 X T EC 1/4 BLW X N TPC 200_BLED FOR RECOR	NG TO 11440' I Is directionally drilled. NG TO 11440' LINE @ 9491'. X CAP CIBP SA 8000 PSI X OK. W OUT OF TBG 900 X AIR 3-1/2 L SURF X SWB O X BLED DWN PC 420. BLED NO GAS X RIH DWN X 2 MIN D GIASS

se Se