

16. If required stimulate w/ 2500 gals 15 % hcl acid w/ 25% methanol per volume of acid dropping 75 - 1.3 RCN ball sealers evenly spaced during job, at 4 to 5 BPM and 7000 psi max pressure.
17. RU swab and swab well back for clean up.
18. Place well on production and repair production unit as needed for production. Release all equipment.