

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.O.S.	<input checked="" type="checkbox"/>
LAND OFFICE	<input checked="" type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

CONSERVATION DIVISION
RECEIVED BY P. O. BOX 2088
SANTA FE, NEW MEXICO 87501
MAR 12 1986
O. C. D.
ARTESIA OFFICE

Form C-103
Revised 10-1-

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	3a. Indicate Type of Lease State <input type="checkbox"/> Fee <input checked="" type="checkbox"/>
2. Name of Operator Pogo Producing Company	5. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 10340 Midland, Texas 79702	7. Unit Agreement Name
4. Location of Well UNIT LETTER J, 1780 FEET FROM THE South LINE AND 2460 FEET FROM East THE LINE, SECTION 14 TOWNSHIP 24-S RANGE 28-E NMPM.	8. Farm or Lease Name Lightfoot "COM"
	9. Well No. 1
	10. Field and Pool, or Wildcat Malaga Atoka
15. Elevation (Show whether DF, RT, GR, etc.) 2977' GR 2998' KB	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	


7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify NMOC in Artesia @ 505-748-1283 of intent to plug w/sufficient time to witness.
2. MIRU, kill well & install BOP.
3. RIH w/2 3/8" tbg open ended to top CIBP at 11,460' & circ hole w/mud using 25# of salt gel/bbl 10# BW.
4. Spot 25 sxs cmt on top CIBP @ 11,460'.
5. POH to 9530' and spot 25 sxs.
6. POH to 8130' and spot 40 sxs.
7. POH to 6350' and spot 40 sxs.
8. POH to 4775' and spot 40 sxs.
9. POH w/tbg.
10. ND wellhead & RU csg jack, & find free point. Cut 9 5/8" csg @ free point.
11. POH w/csg

Notify NMOC in sufficient time to witness

Plugging

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Petroleum Engineer	DATE 3/11/86
PROVED BY	Original Signed By Mike Williams Oil & Gas Inspector	DATE MAR 25 1986