

Bureau of Land Management and
New Mexico Oil Conservation Division
Approved Plugging Procedure

Set the following 100'/25 sx cement plugs. Fill the hole with
9 ppg mud between the plugs:

CIBP @ 11450 plus 35 SX CMT. <=== Must be tagged.
11150'-11250' (Atoka)
10910'-11010' (Top of 4 1/2" Liner)
9550'-9650' (Wolfcamp)
7650'-7750' (7" Csg. Stub) <=== Must be tagged.
6000'-6100' (Bone Springs)
2500'-2600' (9 5/8" Csg. Shoe)
2270-2370' (Salt)
387'-487' (13 3/8" Csg. Shoe)
10' surface plug with marker.