

- 11) POOH with 2 3/8" tubing to 6100' (Wolfcamp) and pump 100' balanced plug 50' above and below this depth.
- 12) POOH with 2 3/8" tubing to 2370' (Salt) and pump 100' balanced plug 50' above and below this depth.
- 13) POOH with 2 3/8" tubing to 500'. Spot 100' balanced plug from 500 to 400 at 10 3/4" surface casing shoe.
- 14) POOH with tubing. Spot 10 sack top plug. Cut off Casing 4' below ground level and weld plate on casing. Install Dry Hole Marker. Remove all surface equipment and above ground pipe. Level and grade location. Remove all HOC signs.

fm