E	* ***			L
Form 3160-5 (June 1990)		TED STATES		FORM APPROVED Budget Burean No. 1004-01
		LAND MANAGEMENT		Expires: March 31, 1993
				5. Lease Designation and Serial Ne
-	SUNDRY NOTICES	AND REPORTS ON	WELLS	0. If Indian, Allottee or Tribe Nam
	his form for proposals to d Use "APPLICATION FC	rill or to deepen or reen PR PERMIT—" for such	try to a different reser proposals	voir.
1. Type of Well	SUBMI	T IN TRIPLICATE	RECEIVED	7. If Unit or CA, Agreement Desig
Oil Well 2. Name of Operator	Gas Weil X Other Wtr Inj		APR - 1 1991	8. Well Name and No.
Union Oil 3. Address and Telep	Company of Californ	uia 🗸	O. C. D. ARTESIA, OFFICE	Wersell Federal 9. API Weil No.
	c 671 - Midland, TX 7		682-9731	3001544845 10. Field and Pool, or Exploratory
4. Location of Well ((Footage, Sec., T., R., M., or Survey I	Description)		Esperanza (Delay
	& 660' FWL			11. County or Parish, State
	2 000 FWL [-22-S, R-27-E			Eddy County, New
		STO INDICATE NAT	TYPE OF AC	
	lotice of Intent	Abendony		······
				New Construction
L su	ubsequent Report	Plugging	Back	Non-Routine Fracturing
	inal Abandonment Notice		•	Water Shut-Off
	Inter Additionalization Notice			Conversion to Injection
			dd perfs & acidi	LZC Dispose Water (Note: Report results of multiple completi
13. Describe Proposed	or Completed Operations (Clearly state a	I pertinent details and give meri-	datas includios anti-	(Note: Report results of multiple complete
•••••••••••••••••••••••••••••••••••••••		ll pertinent details, and give pertinent cal depths for all markers and zones	dates, including estimated date of pertinent to this work.)*	(Note: Report results of multiple completi Completion or Recompletion Report and starting any proposed work. If well is direction
13. Describe Proposed give subsurfac <u>REASON</u> FOI <u>PROCEDURE</u> :	R WORK: To add p	ll pertinent details, and give pertinent cal depths for all markers and zones	dates, including estimated date of pertinent to this work.)*	(Note: Report results of multiple complete
REASON FOI PROCEDURE:	R WORK: To add p injectic DDPU. Install B	Il pertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure.	dates, including estimated date of pertinent to this work.)* to increase i	(Note: Report results of multiple complete Completion or Recompletion Report and starting any proposed work. If well is direction .njectivity and redu
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/	R WORK: To add p injectic DDPU. Install B /bit on 2-7/8" WS	Il pertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure.	dates, including estimated date of pertinent to this work.)* to increase i	(Note: Report results of multiple complete Completion or Recompletion Report and starting any proposed work. If well is direction .njectivity and redu
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to	R WORK: To add p injectic DDPU. Install B /bit on 2-7/8" WS 0 4000'. POOH.	Upertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH W/tbc . Tag top of f	dates, including estimated date of pertiment to this work.)* to increase i & pkr. ill. If tag	(Note: Report results of multiple completi- Completion or Recompletion Report and starting any proposed work. If well is direction .njectivity and redu is above 4000',
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across	R WORK: To add p injectic DDPU. Install B /bit on 2-7/8" WS 0 4000'. POOH. W/WS. Spot 500 g interval 3300-2	Depriment details, and give pertiment cal depths for all markers and zones on pressure. OP. POOH w/tbc . Tag top of f al double inhik 800'. POOH.	dates, including estimated date of pertinent to this work.)* to increase i & pkr. fill. If tag pited 15% HCl	(Note: Report results of multiple completi- Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo	R WORK: To add p injectio DDPU. Install E /bit on 2-7/8" WS 0 4000'. POOH. W/WS. Spot 500 g interval 3300-2 ollo. Perforate	U pertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH w/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand to	dates, including estimated date of pertinent to this work.)* to increase i & pkr. fill. If tag pited 15% HCl	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo	R WORK: To add p injectio DDPU. Install E /bit on 2-7/8" WS 0 4000'. POOH. W/WS. Spot 500 g interval 3300-2 ollo. Perforate	U pertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH w/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand to	dates, including estimated date of pertinent to this work.)* to increase i & pkr. fill. If tag pited 15% HCl	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total	R WORK: To add p injection DDPU. Install B /bit on 2-7/8" WS 0 4000'. POOH. V/WS. Spot 500 g interval 3300-2 Dlo. Perforate 2902', 2930-45', 138'/552 holes)	Upertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH W/tbc . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo.	dates, including estimated date of pertiment to this work.)" to increase i % pkr. fill. If tag pited 15% HCl 1/4" DP csg gu 38', and 3053 PU Smith	(Note: Report results of multiple completi- Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST n & 4 JSPF: (depths -93' referencing Schum (NU data d x 24 a
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ W/spot	R WORK: To add p injection DDPU. Install B /bit on 2-7/8" WS 0 4000'. POOH. V/WS. Spot 500 g interval 3300-2 ollo. Perforate 2902', 2930-45', 138'/552 holes) /5-1/2" pkr & set cacid. then acid	Upertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH W/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo. @ ±2780'. Bre ize all perfs 2	dates, including estimated date of pertinent to this work.)" to increase i s & pkr. Fill. If tag pited 15% HCl y/4" DP csg gu 38', and 3053 RU Smith akdown perfs	(Note: Report results of multiple completi- Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST n & 4 JSPF: (depths -93' referencing Schum CNL dated 5-24-8 2880-3093'
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ W/spot gal to	R WORK: To add p injection DDPU. Install E (bit on 2-7/8" WS 0 4000'. POOH. W/WS. Spot 500 g interval 3300-2 ollo. Perforate 2902', 2930-45', 138'/552 holes) (5-1/2" pkr & set acid, then acid otal 15% HCl w/NE	Upertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH w/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo. @ ±2780'. Bre ize all perfs 2 . FE. & LST usi	dates, including estimated date of pertinent to this work.)" to increase i f & pkr. Fill. If tag pited 15% HCl y/4" DP csg gu 38', and 3053 RU Smith akdown perfs 832-3794' dow	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST n & 4 JSPF: (depths -93' reference on Schum CNL dated 5-24-8 2880-3093' n WS w/10,000
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ w/spot gal to stages	R WORK: To add p injection DDPU. Install B /bit on 2-7/8" WS 0 4000'. POOH. WWS. Spot 500 g interval 3300-2 ollo. Perforate 2902', 2930-45', 138'/552 holes) /5-1/2" pkr & set cacid, then acid otal 15% HCl w/NE s, diverting w/45	Upertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH w/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo. @ ±2780'. Bre ize all perfs 2 , FE, & LST usi 0# GRS in 10 pp	dates, including estimated date of pertinent to this work.)" to increase i f & pkr. Fill. If tag pited 15% HCl y/4" DP csg gu 38', and 3053 RU Smith akdown perfs 832-3794' dow	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST n & 4 JSPF: (depths -93' reference on Schum CNL dated 5-24-8 2880-3093' n WS w/10,000
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ w/spot gal to stages max pr	R WORK: To add p injection DDPU. Install B /bit on 2-7/8" WS 0 4000'. POOH. WWS. Spot 500 g interval 3300-2 ollo. Perforate 2902', 2930-45', 138'/552 holes) /5-1/2" pkr & set acid, then acid otal 15% HCl w/NE is, diverting w/45 ressure. RD Smit	Upertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH w/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo. @ ±2780'. Bre ize all perfs 2 , FE, & LST usi 0# GRS in 10 pp	dates, including estimated date of pertinent to this work.)" to increase i f & pkr. Fill. If tag pited 15% HCl y/4" DP csg gu 38', and 3053 RU Smith akdown perfs 832-3794' dow	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST n & 4 JSPF: (depths -93' reference on Schum CNL dated 5-24-8 2880-3093' n WS w/10,000
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ w/spot gal to stages max pr 6. Flow/s	R WORK: To add p injection DDPU. Install E /bit on 2-7/8" WS 0 4000'. POOH. WWS. Spot 500 g interval 3300-2 010. Perforate 2902', 2930-45', 138'/552 holes) /5-1/2" pkr & set acid, then acid 0 tal 15% HCl w/NE is, diverting w/45 ressure. RD Smit	Dertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH w/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo. @ ±2780'. Bre ize all perfs 2 , FE, & LST usi 0# GRS in 10 pp h.	dates, including estimated date of pertiment to this work.)" to increase i iill. If tag oited 15% HCl '/4" DP csg gu '38', and 3053 RU Smith akdown perfs 832-3794' dow ng 10# BW to g GBW @ 3-6 B	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction injectivity and redu w/NE, FE, & LST n & 4 JSPF: (depths -93' referencing Schum CNL dated 5-24-8 2880-3093' n WS w/10,000 mix in 10 equal PM & 3000 psi
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ W/spot gal to stages max pr 6. Flow/s 7. POOH W	R WORK: To add p injection DDPU. Install B /bit on 2-7/8" WS 0 4000'. POOH. WWS. Spot 500 g interval 3300-2 ollo. Perforate 2902', 2930-45', 138'/552 holes) /5-1/2" pkr & set acid, then acid otal 15% HCl w/NE is, diverting w/45 ressure. RD Smit wab back load. WWS & pkr. Run	Dertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH w/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo. @ ±2780'. Bre ize all perfs 2 , FE, & LST usi 0# GRS in 10 pp h.	dates, including estimated date of pertiment to this work.)" to increase i iill. If tag oited 15% HCl '/4" DP csg gu '38', and 3053 RU Smith akdown perfs 832-3794' dow ng 10# BW to g GBW @ 3-6 B	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', w/NE, FE, & LST n & 4 JSPF: (depths -93' reference on Schum CNL dated 5-24-8 2880-3093' n WS w/10,000
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ W/spot gal to stages max pr 6. FloW/s 7. POOH W	R WORK: To add p injection DDPU. Install E /bit on 2-7/8" WS 0 4000'. POOH. WWS. Spot 500 g interval 3300-2 010. Perforate 2902', 2930-45', 138'/552 holes) /5-1/2" pkr & set acid, then acid 0 tal 15% HCl w/NE is, diverting w/45 ressure. RD Smit	Dertinent details, and give pertinent cal depths for all markers and zones oay and acidize on pressure. OP. POOH w/tbo . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo. @ ±2780'. Bre ize all perfs 2 , FE, & LST usi 0# GRS in 10 pp h.	dates, including estimated date of pertinent to this work.)" to increase i s & pkr. Fill. If tag oited 15% HCl y/4" DP csg gu 38', and 3053 RU Smith sakdown perfs 832-3794' dow ng 10# BW to g GBW @ 3-6 B ment & return	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction injectivity and redu w/NE, FE, & LST n & 4 JSPF: (depths -93' referencing Schum CNL dated 5-24-8 2880-3093' n WS w/10,000 mix in 10 equal PM & 3000 psi well to injection.
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ W/spot gal to stages max pr 6. FloW/s 7. POOH W 14. 1 hereby certify the Signed	R WORK: To add p injection DDPU. Install B /bit on 2-7/8" WS 0 4000'. POOH. V/WS. Spot 500 g s interval 3300-2 ollo. Perforate 2902', 2930-45', 138'/552 holes) /5-1/2" pkr & set cacid, then acid of al 15% HCl w/NE s, diverting w/45 ressure. RD Smit swab back load. //WS & pkr. Run	Delaware Sand w 2955-90', 3012- RD Apollo. 0 ±2780'. 0 # GRS in 10 pp 10 pr 10 p	dates, including estimated date of pertinent to this work.)" to increase i s & pkr. Fill. If tag oited 15% HCl y/4" DP csg gu 38', and 3053 RU Smith sakdown perfs 832-3794' dow ng 10# BW to g GBW @ 3-6 B ment & return	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction injectivity and redu w/NE, FE, & LST n & 4 JSPF: (depths -93' referencing Schum CNL dated 5-24-8 2880-3093' n WS w/10,000 mix in 10 equal PM & 3000 psi
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ W/Spot gal to stages max pr 6. FloW/S 7. POOH W 14. I hereby certify the Signed	R WORK: To add p injectic DDPU. Install E /bit on 2-7/8" WS 0 4000'. POOH. V/WS. Spot 500 g interval 3300-2 010. Perforate 2902', 2930-45', 138'/552 holes) '5-1/2" pkr & set acid, then acid 0tal 15% HCl w/NE s, diverting w/45 ressure. RD Smit swab back load. V/WS & pkr. Run at the foregoing is true and correct whethe Meeson deral or State office use)	Delaware Sand w 2955-90', 3012- RD Apollo. 0 ±2780'. 0 # GRS in 10 pp 10 pr 10 p	dates, including estimated date of pertinent to this work.)" to increase i s & pkr. Fill. If tag oited 15% HCl y/4" DP csg gu 38', and 3053 RU Smith sakdown perfs 832-3794' dow ng 10# BW to g GBW @ 3-6 B ment & return	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction injectivity and redu w/NE, FE, & LST n & 4 JSPF: (depths -93' referencing Schum CNL dated 5-24-8 2880-3093' n WS w/10,000 mix in 10 equal PM & 3000 psi well to injection.
REASON FOI PROCEDURE: 1. MI RU 2. RIH W/ C/O to 3. RBIH W across 4. RU Apo 2880-2 (total 5. RIH W/ W/spot gal to stages max pr 6. FloW/s 7. POOH W 14. I hereby certify the Signed (This space for Fee Approved by Cynditigns of appro- Conditions of appr	R WORK: To add p injectic DDPU. Install E /bit on 2-7/8" WS 0 4000'. POOH. V/WS. Spot 500 g interval 3300-2 010. Perforate 2902', 2930-45', 138'/552 holes) '5-1/2" pkr & set acid, then acid 0tal 15% HCl w/NE s, diverting w/45 ressure. RD Smit swab back load. V/WS & pkr. Run at the foregoing is true and correct whethe Meeson deral or State office use)	Dertinent details, and give pertinent cal depths for all markers and zones on pressure. OP. POOH W/tbc . Tag top of f al double inhik 800'. POOH. Delaware Sand w 2955-90', 3012- . RD Apollo. @ ±2780'. Bre ize all perfs 2 , FE, & LST usi 0# GRS in 10 pp h. 	dates, including estimated date of pertinent to this work.)" to increase i s & pkr. Fill. If tag oited 15% HCl y/4" DP csg gu 38', and 3053 RU Smith sakdown perfs 832-3794' dow ng 10# BW to g GBW @ 3-6 B ment & return	(Note: Report results of multiple completion Completion or Recompletion Report and starting any proposed work. If well is direction is above 4000', W/NE, FE, & LST n & 4 JSPF: (depths -93' referencing Schlum CNL dated 5-24-8 2880-3093' n WS w/10,000 mix in 10 equal PM & 3000 psi well to injection.