merty 9-331 DEPARTMI FOF THE INTERIOR retre side	5. LEASE DESIGNATION AND SERIAL
BUREAU OF LAND MANAGEMENT	MM-0404441 6. IF INDIAN, ALLOTTEE OR TRIBE NAME
SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposais to drill or to deepen or plug back to a different reserve Use "APPLICATION FOR PERMIT-" for such proposais.)	7. UNIT AGREEMENT NAME
TELL CAS WELL OTHER Dry Hole RECEIVED BY	CONTRAGREEMENT NAME
Union Oil Company of California JUN 23 1986	8. FARM OR LEAST NAME Barclay "11" Federal
D,	9. WELL NO.
P. O. Box 671 Midland, Texas 79702 O. C. CFFKE OCATION OF WELL (Report location clearly and in accordance with any State ALE ON A ter also space 17 below.)	10. FIELD AND POOL OR WILDCAT
2180' FNL and 660' FEL	Undesignated (Morrow) 11. SEC., T., E., M., OR BLE, AND SUBVET OB AREA
ERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.)	Sec 11, T-23-S, R-31-E
GR 3490', DF 3514', KB 3515'	12. COUNTY OR PARISH 13. STATE Eddy NM
Check Appropriate Box To Indicate Nature of Notice, Report, or t	Other Data
	QUENT REPORT OF :
TEST WATER SHUT-OFF PULL OR ALTER CASING WATER SHUT-OFF	BEPAIRING WELL
FRACTURE TREAT MULTIPLE COMPLETE FRACTURE TREATMENT	ALTERING CASING
SHIGHT OR ACIDIZE ABANDON" SHOOTING OR ACIDIZING REPAIR WELL CHANGE FLANS (Other)	ABANDONMENT*
(Nors: Report result	is of multiple completion on Well pletion Report and Log form.
nent to tais wors.) -	cai depths for all markers and zones perti-
Final procedure performed in plugging subject well as compare on application for permission to P&A: 7 - Set CIBP @ 9150' and Dumped 35' of cement on top 8 - Mixed 10 PPG mud - Set 50 sacks of Class "C" cement @ 6948 9 - Cut and pulled 4300' of 7-5/8" casing 0 - Pumped 105 sacks cement at 4600', Tagged at 4280' 1 - Pumped 105 sacks Class "C" cement @ 3300' 2 - Pumped 125 sacks Class "C" cement @ 850', Tagged @ 820' 3 - Pumped 125 sacks Class "C" cement @ 820', Tagged @ 640' 4 - Pumped 50 sacks of Class "C" cement @ 640' 5 - Tagged plug at 495', Put in 20 sack surface plug 6 - Cut off well head and installed dry hole marker 7 - Removed all equipment and cleaned location	
Final procedure performed in plugging subject well as compare on application for permission to P&A: 7 - Set CIBP @ 9150' and Dumped 35' of cement on top 8 - Mixed 10 PPG mud - Set 50 sacks of Class "C" cement @ 6948 9 - Cut and pulled 4300' of 7-5/8" casing 0 - Pumped 105 sacks cement at 4600', Tagged at 4280' 1 - Pumped 105 sacks Class "C" cement @ 3300' 2 - Pumped 125 sacks Class "C" cement @ 850', Tagged @ 820' 3 - Pumped 125 sacks Class "C" cement @ 820', Tagged @ 640' 4 - Pumped 50 sacks of Class "C" cement @ 640' 5 - Tagged plug at 495', Put in 20 sack surface plug 6 - Cut off well head and installed dry hole marker 7 - Removed all equipment and cleaned location	cal depths for all markers and zones perti-
Final procedure performed in plugging subject well as compare on application for permission to P&A: 7 - Set CIBP @ 9150' and Dumped 35' of cement on top 8 - Mixed 10 PPG mud - Set 50 sacks of Class "C" cement @ 6948 9 - Cut and pulled 4300' of 7-5/8" casing 0 - Pumped 105 sacks cement at 4600', Tagged at 4280' 1 - Pumped 105 sacks class "C" cement @ 3300' 2 - Pumped 125 sacks Class "C" cement @ 850', Tagged @ 820' 3 - Pumped 125 sacks Class "C" cement @ 820', Tagged @ 640' 4 - Pumped 50 sacks of Class "C" cement @ 640' 5 - Tagged plug at 495', Put in 20 sack surface plug 6 - Cut off well head and installed dry hole marker 7 - Removed all equipment and cleaned location bereby fruity that the foregoing is true and correct IGNERT MARK J. R. Hughes TITLE Dist. Drlg. Supt.	ed to items 7 thru 15 B' Pot I D- 2 1/-25-88
Final procedure performed in plugging subject well as compare on application for permission to P&A: 7 - Set CIBP @ 9150' and Dumped 35' of cement on top 8 - Mixed 10 PPG mud - Set 50 sacks of Class "C" cement @ 6948 9 - Cut and pulled 4300' of 7-5/8" casing 0 - Pumped 105 sacks cement at 4600', Tagged at 4280' 1 - Pumped 780 sacks Class "C" cement @ 3300' 2 - Pumped 125 sacks Class "C" cement @ 850', Tagged @ 820' 3 - Pumped 125 sacks of Class "C" cement @ 820', Tagged @ 640' 4 - Pumped 50 sacks of Class "C" cement @ 640' 5 - Tagged plug at 495', Put in 20 sack surface plug 6 - Cut off well head and installed dry hole marker 7 - Removed all equipment and cleaned location bereby writhy that the foregoing is true and correct bereby writhy that the foregoing is true and correct	Cal depths for all markers and zones perti- ed to items 7 thru 15 3' <i>Pot ID-3</i> 1/-35-88 <i>P</i> 4 A 4-23-86

*See Instructions on Reverse Side