

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED
MAY 31 1991
O. C. D.
ARTESIA OFFICE

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

BTA Oil Producers

3. Address and Telephone No.

104 S. Pecos, Midland, TX 79701

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

2210' FNL & 660' FWL
Sec 34, T23S, R24E

5. Lease Designation and Serial No.

NM 69342

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Tank B, 8710 JV-P #1

9. API Well No.

30-015-25874

10. Field and Pool, or Exploratory Area

Crooked Creek

11. County or Parish, State

Eddy Co., NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent

☐ Subsequent Report

☒ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Procedure:

1. Notify BLM 505/887-6544 24 hrs in advance.
2. MIRU pulling unit, frac tank & H₂S Safety equipment.
3. Kill well. ND tree. NU BOP.
4. Release packer & POH w/tbg & pkr.
5. PU ret tool on tbg, TIH, Rev circ ball sealers & snd off RBP @ 8502'. Latch onto RBP & POOH.
6. TIH w/tbg open-ended to 8930'.
7. Circ hole w/9.3# gal mud. Spot 30' cmt on CIBP @ 8930'. POOH w/tbg.
8. PU 5-1/2" CIBP on tbg. RIH to 7960', Spot 50' cmt on CIBP.
9. Spot 100' cmt @ 2650-2550'.
10. Spot 100' cmt @ 458-358'.
11. Cut off well hd & spot 50' cmt @ surface.
12. Install dry hole marker.

14. I hereby certify that the foregoing is true and correct

Signed

Title Regulatory Administrator

Date 5-21-91

(This space for Federal or State office use)

Approved by

Title

Date

5/29/91

Conditions of approval, if any:

[REDACTED]