

Wersell ' ' #2
Continue completion

Spot 200 gal 10% acetic acid @ 3830'.

Perforate Tracy 3804-12 & Brushy Canyon 3827-30 w/2SPF.

Breakdown perfs 3804-30 w/perf acid.

Acidize perfs 3804-30 w/1200 gals Delaware acid
diverting w/50 (1.3 sp gr) BS.

Swab test & evaluate (further recommendation will be
based on test results).

Spot 600 gals Delaware acid @ 3284'.

Perofate Dimmitt 3278-84 w/2 SPF.

Breakdown & acidize Dimmitt w/perf acid.

Swab test & evaluate (further recommendation will be
based on test results).

Spot 600 gals Delaware acid @ 3174'.

Perforate Manzanita 3170-74' w/2 SPF.

Breakdown & acidize Manzanita w/perf acid.

Swab test & evaluate (further recommendation will be
based on test results).

Spot 200 gals 15% HCl acid w/additives @ 2600'.

Perforate Bell Canyon 2550-2600' w/2 SPF.

Breakdown Bell Canyon perfs w/perf acid.

Acidize Bell Canyon Lime 2550-2600 w/5000 gals 15% HCl
acid w/additives diverting w/150 (1.3 sp. gr.) BS.

Swab test & evaluate (further recommendation will be
based on test results).

Spot 200 gals 10% acetic acid @ 2032'.

Perforate Bell Canyon Sand 2012-32 w/2 SPF.

Breakdown Bell Canyon perfs w/perf acid.

Acidize Bell Canyon sand w/7-1/2% Delaware acid
diverting w/60 (1.3 sp gr) BS.

Swab test & evaluate (further recommendation will be
made on test results).

Place well on production.