

- 11-10-92: Continue in hole with 2-7/8" workstring. Tagged sand (fill) @ 6025'.  
Cleaned out sand to 6180' (RBP). POOH with notched collar and tubing.  
Picked up 5-1/2" packer on 2-7/8" workstring. Set packer @ 6035'.  
Swabbed.
- 11-13-92: Unseat packer & wash sand from RBP. Retrieve RBP & move up hole to  
5850'. Set & test. Dump sand on RBP. Spot 500 gals 20% acetic acid.  
Perforated 5-1/2" casing from 5706'-5748'. POOH and rig down. WIH  
with 5-1/2" packer on work tubing. Set packer @ 5248'. Swabbed.
- 11-16-92: Swabbed.
- 11-17-92: Swabbed. Unseat packer and POOH. Picked up 5-1/2" packer on 3-1/2"  
workstring and WIH. Set packer @ 5648'.
- 11-18-92: Treat the Delaware perfs. 5706-5748'. Treated with 31,000 gals 35#  
borate x-linked gelled 2% KCL water pad and 4350 gals 35# gelled 2%  
KCL water carrying 26,375# of 20/40 mesh ottawa sand and 9,000# of  
16/30 mesh ottawa sand.
- 11-19-92: RIH with 5-1/2" packer on 2-7/8" tubing and set packer @ 5625'.  
Swabbed.
- 11-20-92: Swabbed.
- 11-23-92: Unseat packer and circulate sand from RBP. Retrieve RBP and pull to  
5600' and set and test to 1,000#. Dump 2 sx of sand on RBP. POOH with  
tubing and packer.
- 11-24-92: Perforated the 5-1/2" casing w/ 4" casing gun from 5452'-5499' (48  
shots). POOH with perforating guns. Picked up 5-1/2" packer on tubing  
and WIH. Set packer at 4996'. Swabbed.
- 11-25-92: Swabbed. Unseat packer and POOH. Run 5-1/2" packer on 3-1/2" treating  
tubing and WIH. Set packer @ 5397'.
- 11-30-92: Treated the Delaware perforations 5452'-5499' with 29,000 gals 35#  
borate x-linked gelled 2% KCL water pad and 5,500 gals 35# gelled 2%  
KCL water carrying 33,250# of 20/40 mesh ottawa sand and 11,000# of  
16/30 mesh ottawa sand.
- 12-1-92: Checked for fill. Tagged at 5596'. Unseat packer and pull packer and 3-1/2"  
workstring from well. Picked up 5-1/2" packer on 2-7/8" tubing and  
WIH. Set packer at 5395'. Swab.
- 12-2-92: Swabbed.
- 12-3-92: Swabbed.
- 12-4-92: Swabbed.
- 12-7-92: Swabbed.
- 12-8-92: Swab.