

Lamb Chop 17 State Com #1

P&A Procedure

Page 2

- Set 100' plugs across base and top of salt inside 8 5/8" casing
6. Spot 65 sx C1 "C" plug @ 2882' (Cover Delaware top and 8-5/8" shoe).
 7. Set CIBP @ $\pm 1600'$. Spot 45 sx C1 "C" @ 1550' (Cover CIBP, ECP, and DV tool).
 8. Spot 30 sx C1 "C" plug @ 473'. (Cover 13-3/8" casing shoe)
 9. Spot 15 sx C1 "C" plug @ 50'.
 10. Cut off wellhead 3' below ground level and install dry hole marker.
 11. Clean location.

Attached is a wellbore diagram for your convenience.