

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

C157
up

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-015-26613

5. Indicate Type of Lease
STATE FEE

6. State Oil & Gas Lease No.
G-575 & NM-VB-193

7. Lease Name or Unit Agreement Name
Lamb Chop 17 State Com

8. Well No.
1

9. Pool name or Wildcat
Mosley Canyon Strawn (Gas)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

RECEIVED

JUL 18 '94

1. Type of Well:
OIL WELL GAS WELL OTHER O. C. D.

2. Name of Operator
Santa Fe Energy Operating Partners, L.P. ARTESIA, OFFICE

3. Address of Operator
550 W. Texas, Suite 1330, Midland, Texas 79701

4. Well Location
Unit Letter 0 : 660 Feet From The South Line and 2310 Feet From The East Line
Section 17 Township 24S Range 25E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4308' KB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The following work will start on approximately August 5, 1994:

1. Notify OCD 24 hours prior to beginning operations.
2. Set CIBP via tubing at 10,110'. Circ hole w/ 9.5# mud. Spot 15 sx C1 "H" cmt plug on top of CIBP. POH w/ tbg.
3. Run free-point on 5-1/2" casing. Cut casing off and pull same. The remainder of the procedure assumes a free-point & cut off at about 8700'.
4. Spot 40 sx C1 "C" plug 50' inside 5-1/2" casing stub (Will also cover Wolfcamp top).
5. Spot 45 sx C1 "C" plug @ 5482'. (cover Bone Spring top)

cont.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Terry McCullough TITLE Sr. Production Clerk DATE July 15, 1994
TYPE OR PRINT NAME Terry McCullough TELEPHONE NO. 915/ 687-3551

(This space for State Use)
APPROVED BY [Signature] TITLE SUPERVISOR, DISTRICT II DATE 7-26-94
CONDITIONS OF APPROVAL, IF ANY: