

James E No. 12

9-05-92 (Cont'd)

Release pkr. and COOH w/3-1/2" tbg. Go in with 2-7/8" tubing and pkr. Pkr set at 5786'.

9-08-92 Swab.

9-09-92 Swab.

9-10-92 Swab. Release pkr. and go in hole and tag top of RBP. Circulate hole and catch plug. Release RBP and go in hole to a depth of 6900'. Set plug and pkr. Test plug to 1000 psi. Release pkr. and start out of hole w/2-7/8" tbg.

9-11-92 COOH w/2-7/8" pkr. GIH w/2-7/8" prod. tubing. Tubing set at 5730'. SN at 5700' Tbg. Anchor at 5640'. Run rods and pump in well. Put well on pump.

Oct. 6, 1992: 30 BO; 97BW.  
TEMPORARILY DROP FROM REPORT.