Submit 3 Copies Submit 3 Copies District Office		ew Mexico pural Resources Department	Form C-103 Revised 1-1-89
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVA P.O. B	WELL API NO.	
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New M	exico 8750#13088 3 1992	S. Indicate Type of Leese STATE FEE X
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 874	10	O. C. D. embra, office	6. State Oil & Gas Lease No.
(DO NOT USE THIS FORM FOR DIFFERENT RE (FOR	OTICES AND REPORTS OF PROPOSALS TO DRILL OR TO DE SERVOIR. USE "APPLICATION F M C-101) FOR SUCH PROPOSAL	EEPEN OR PLUG BACK TO A FOR PERMIT"	7. Lease Name or Unit Agreement Name Pardue Farms 26
1. Type of Well: OL GAS WELL X WELL	OTHER.		
2. Name of Operator Parker & Parsley D	evelopment Company	V	8. Well No. 4
3. Address of Operator			9. Pool same or Wildcat
P.O. Box 3178, Mid	land, Texas 79702		East Loving Delaware
4. Well Location Unit Letter :	2100 Feet From The Wes	t Line and 56	O Feet From The North Line
Section 26	Township 23S		NMPM Eddy County
	10. Elevation (Show	whether DF, RKB, RT, GR, etc.)	
	ck Appropriate Box to Inc	3016 GR	enort, or Other Data
	CK Appropriate Box to like INTENTION TO:		SEQUENT REPORT OF:
r	–		ALTERING CASING
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	
PULL OR ALTER CASING		CASING TEST AND C	
OTHER:		OTHER: Pump	Test Bone Springs X
12. Describe Proposed or Completed work) SEE RULE 1103. See Attached Report		esaus, ana give perioeni caes, secia	ding estimated date of starting any proposed
TYPE OR PRINT NAME St (This space for State Use)	e is true and complete to the best of my known of the best of the	mm.e Proration A	915- TELEPHONE NO. 683-4768 AUG 17 1992
APPROVED BY	The second of th	TILE	DATE —
CONDITIONS OF APPROVAL, IF ANY			

PARDUE FARMS 26 #4
"C", S. 26, T23S, R28E

SUNDRY NOTICE July 31, 1992

- 7/27/92 TIH, tag'd CIBP @ 6268'. Push & drl out CIBP to 6682' (PBTD @ 6764'). Bit locked up. POH w/ tools, lost cones. SDFN.
- 7/28/92 RIH w/ junk basket. Tag'd up on sd @ 6662'. CO sd & worked on CIBP to 6686'. Tools started sticking. POH, recovered sd & 1 cone. SDFN.
- 7/29/92 RIH w/ tbg. Landed tbg @ 6165'. SN @ 6100', TAC @ 5846'. RIH w/ 2"x1-1/4"x16' pump. Space out & hung well on @ 3:00 pm. Check well @ 4:30 pm, polish rod bent over. MIRU PU. Unseat pmp, POH w/ rods. Rods apparently stuck due to paraffin. SDFN.
- 7/30/92 Hot wtr w/ 70 BPW dwn backside & hot oil tbg w/ 40 BO + 10 gals paraffin dispersant. Redress pmp & RIH. Space out & hang well on. Start 30 day test.