

WELL: PARDUE FARMS "27" #9 (DW)
PROJECT: PPDC - 93.90625%

STATE: NM
COUNTY: EDDY

TD: 6,800

11/03/91 TD 6800'; RDRT: Ran Weatherford FS, 4-1/2" 11.6#, K-55 LTC shoe joint, Weatherford FC, 4 jts 4-1/2" 11.6#, K-55 LTC csg, 1 short marker jt (25', T @ 6583') of same csg, 23 jts of same csg, Weatherford 4860-B DV Tool (T @ 5699') & 149 jts of same csg. Set csg @ 6802' & D-S cmt'd 1st stage w/80 sks 65/35 Poz-C + 4% gel + 3-1/2#/sk salt + 1/4#/sk celloflakes lead & 245 sks 10:10 Self Stress tail. Circ 46 bbls cmt thru DV, plug dwn @ 2:40 p.m., 11/02/91. 2nd Stage, 680 sks 65/35 lead & 245 sks S.S. tail, plug dwn @ 8:07 p.m., 11/02/91. Set slips, cut off RDRT. Rig Released @ 11:00 p.m., 11/02/91.

11/04/91 (10/03/91 report cont'd) MORT.

11/05/91 WOPU.

11/06/91 WOPU.

11/07/91 WOPU.

11/08/91 MIRU Clarke W.S. PU RIH w/3-7/8" bit, csg scraper, (6) 3-1/8" DC's & 2-3/8" tbgs to 5600'. SDFN.

11/09/91 Cont'd in hole w/ tools, drl out DV tool @ 5700', test csg to 1500 psi for 30/min., Ok. Drl out plug & cmt f/5758' to float collar @ 6761'. Drl cmt to 6797', new PBTD. Tst'd csg to 1500 psi, for 30/min., Ok. Circ hole clean. SDFN.

11/10/91 SDFS.

11/11/91 POOH w/ tools. RU Black Warrior WL & ran CNL/CCL f/6797' (PBTD) to 2200'. Ran CBL f/6797' to TOC @ 1874'. Excellent bond throughout. SDFN.

11/12/91 POOH w/ tools. RU Black Warrior & perf Bone Springs @ 6621', 11', 6590', 81', 51', 38', 23', 6455', 47', 18', 6397', 81', 31', 09' (14 Holes @ 1 JSPF, .5" entry using