

Memo

From

RAY SMITH
Field Representative

To Bob Yates
Parker + Parsley
915-571-5527

Step # 3 25 s e 2570'

Bob, we have no record
showing change of operator
on this well. We still have
Graham Royalty as owner
of Nymeyer A# 3.
We need a C104 showing
change of operator.

Thanks
R.S.

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

ATTN: Ray Smith

WELL API NO.	30-015-26905
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	NYMYER "A"
8. Well No.	3
9. Pool name or Wildcat	Undesignated

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER T/A	
2. Name of Operator Parker & Parsley Dev. Co.	
3. Address of Operator P.O. Box 3178, Midland, Tx., 79702	
4. Well Location Unit Letter K : 2130 Feet From The South Line and 1980 Feet From The West Line Section 15 Township 23-S Range 28-E NMPM Eddy County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) RKB - 3011 GR - 2999	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103 (Start: 3-28-94)

1. Set CIBP* @ 6106 8' dump 35' cmt on T/plug w/ SW mud.
2. Spot 25 sx cmt 3854-3754 w/ mud, to cover DVT.
3. Spot 25 sx cmt to cover T/Delaware & 3/salt.
4. Spot 25 sx cmt 605-505' for 8 5/8 shoe plug. Salvage wellheads, surface eqpt.
5. Spot 50 ft. plug in surface.
6. Install D.H. marker at edge of pad, w/ specific directions to P/A borehole.
7. Clean location, backfill cellar, etc.
8. Leave location & road intact at request of farmer (Candillario Carrasco, Jr., Loving, N.M., (505) 745-3342).

NOTE: There will be no Salvaged casing. Refer to attached schematic drawing. Rods and pump jack have been removed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE CONSULTANT DATE 2-21-94
TYPE OR PRINT NAME Bob Yeates TELEPHONE NO. _____

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:



PARKER & PARSLEY
DEVELOPMENT COMPANY

ENGINEERING CHART

SHEET NO. 2 OF 2


SUBJECT

NYMYER "A" No. 3

DATE 2-21-94

BY *Byeater*

PLUG & ABANDON

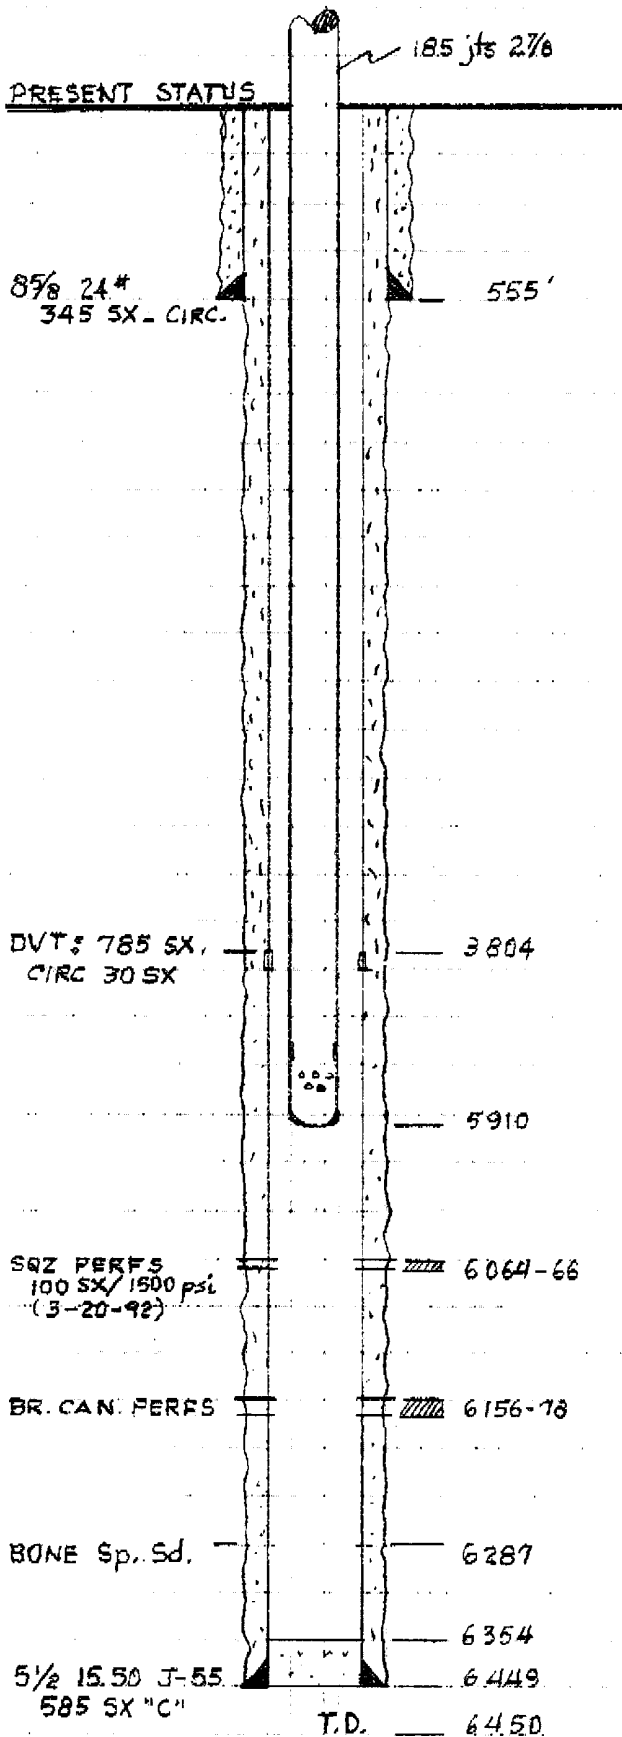

PROCEDURES: (TSG may have been salvaged).