

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other Instructions on re-
verse side)

Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

NM-67980

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Santa Fe Federal

9. WELL NO.

3

10. FIELD AND POOL, OR WILDCAT

E. Herradura Bend Del

11. SEC., T., R., M., OR BLK. AND
SURVEY OR ARMA

35 T22S-R28E

12. COUNTY OR PARISH

Eddy

13. STATE

NM

1. OIL WELL ☒ GAS WELL ☐ OTHER

JUL 3 11 25 AM '92

2. NAME OF OPERATOR

Ray Westall

3. ADDRESS OF OPERATOR

Box 4, Loco Hills NM 88255

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)

At surface

1946 FSL & 626 FEL

14. PERMIT NO.

30-015-27026

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3107 Gr.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

Spud and Cmt

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

6/14/92 Spud 12 $\frac{1}{4}$ " hole @ 9:45 PM

6/15/92 Run 450' 8 5/8" 24# csng. Cmt with 300 sxs Class "C" 2% CaCl
Plug down 1:16 AM circulate 40 sxs to pit.
WOC 18 hrs. pressure test to 800 # held 30 min

6/27/92 TD 6360 Logging with Atlas CNL/FDC

6/28/92 Ran 6360' 5 $\frac{1}{2}$ " J 15.5# csng with DV tool @ 5000'.
Cmt 1st stage with 250 sxs Class "H" plug down 2:30 AM
Circulate 102 sxs to pit. Circulate through DV for four hrs.
2nd stage 1260 sxs super "C" tailed in with 500 sxs Class "H"
Plug down 8:30 AM circulate 315 sxs to pit.
Released rig at 10:00 AM.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Geologist

DATE 7/3/92

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

1992

*See Instructions on Reverse Side

SJS