

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division
FORM APPROVED
811 S. 1st Street
Bureau No. 1034-0135
Artesia, NM 88210-2834

C/91

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT --" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well: ☒ OIL WELL ☐ GAS WELL ☐ OTHER
2. Name of Operator: TEXACO EXPLORATION & PRODUCTION INC.
3. Address and Telephone No.: 205 E. Bender, HOBBS, NM 88240 397-0405
4. Location of Well (Footage, Sec., T., R., M., or Survey Description):
Unit Letter C : 660 Feet From The NORTH Line and 1980 Feet From The
WEST Line Section 13 Township 22-S Range 31-E
5. Lease Designation and Serial No.: NM-29233
6. If Indian, Alottee or Tribe Name:
7. If Unit or CA, Agreement Designation:
8. Well Name and Number: NEFF '13' FEDERAL
9. API Well No.: 30-015-28125
10. Field and Pool, Exploratory Area: LIVINGSTON RIDGE DELAWARE
11. County or Parish, State: EDDY NM

12. Check Appropriate Box(s) To Indicate Nature of Notice, Report, or Other Data

TYPE OF SUBMISSION

TYPE OF ACTION

☐ Notice of Intent	☐ Abandonment	☐ Change of Plans
☒ Subsequent Report	☐ Recompletion	☐ New Construction
☐ Final Abandonment Notice	☐ Plugging Back	☐ Non-Routine Fracturing
	☐ Casing Repair	☐ Water Shut-Off
	☐ Altering Casing	☐ Conversion to Injection
	☒ OTHER: PERF, ACIDIZE, FRAC	☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

11-06-00: MIRU. TIH W/PARAFFIN KNIFE ON RDS TO 6675'. NUBOP.
11-08-00: TIH W/BIT & CSG SCRAPER ON WS TO 5115'.
11-09-00: TIH W/WS TO 6936'. TIH W/RBP & PKR, SN, ON TBG. TIE INTO COLLAR @ 6892'. SET RBP @ 6900'. PU ABOVE RBP & SET PKR.
TEST RBP TO 500#-OK. DUMP 1 SX SAND ON TOP OF RBP.
11-10-00: TIH W/PERF GUN & PERF IN BRUSHY CANYON FORMATION 6836-6844'. TIH W/PKR, SN ON TBG. TEST TO 8000#. SET PKR @ 6436'.
11-13-00: ACIDIZE PERFS IN BRUSHY CANYON 6836-44' W/1000 GALS 15% NEFE HCL. RU SWAB.
11-14-00: TIH W/BAILER ON TBG. TAG TOP OF RBP @ 6900'. PUMP 70 BBLS 2% KCL DN BACKSIDE & WORK BAILER. TIH W/RET TOOL ON TBG. STOP TOOL @ 1256'.
11-15-00: TIH W/TBG & RET TOOL. WASH SAND OFF RBP. LATCH & REL RBP. PULL UP & SET RBP @ 6800'. LOAD & TEST CSG TO 500#-OK. DUMP 7' SAND ON RBP. TIH W/PERF GUN & PERF BRUSHY CANYON 6543-6570'.
11-16-00: TIH W/PKR, SN ON TBG. TEST TO 8000#. SET PKR @ 6405'. ACIDIZE BRUSHY CANYON PERFS 6548-70 W/2200 GALS 15% NEFE HCL. RU SWAB. FL @ SURF. END FL @ 4300'.
11-17-00: SWAB DRY.
11-20-00: WELL FLOW TO FRAC TANK. RU SWAB. FL @ 4000'.
11-21-00: FRAC BRUSHY CANYON PERFS 6548-70 W/12,096 GALS 25# X-LINK GEL.
11-22-00: UNSET PKR. TIH W/COLLAR & BAILER ON TBG. TAG @ 6694'. C/O SAND TO 6791'. TIH W/KILL STRING TO 1251'.
11-27-00: TIH W/PERF GUN & PERF 6736-40. TIH W/PKR ON TBG. SWINGING @ 6468'.
11-28-00: SET PKR @ 6658'. ACIDIZE 6736-40 W/1000 GALS 7 1/2% NEFE HCL.
11-29-00: RU FOAM UNIT. FL @ 5738'. REL PKR. TIH W/RET HEAD ON TBG. BREAK CIRC W/FOAM UNIT. LOWER TOOLS & TAG SAND. WASH SAND OFF RBP TO 6800'. LATCH ON RBP. COULD NOT RELEASE. UNLATCH FROM RBP & PULL TO 6500'.

14. I hereby certify that the foregoing is true and correct.

SIGNATURE: J. Denise Leake TITLE: Engineering Assistant DATE: 1/9/01

TYPE OR PRINT NAME: J. Denise Leake

(This space for Federal or State office use)

APPROVED

CONDITIONS OF APPROVAL IF ANY: TITLE: DATE:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.