

CIS  
OP

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

## OIL CONSERVATION DIVISION

2040 Pacheco St.  
Santa Fe, NM 87505

WELL API NO. 30015-29270
Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
State Oil & Gas Lease No.
Lease Name or Unit Agreement Name F.H. 28 STATE COM
Well No. 2
Pool name or Wildcat CARLSBAD SOUTH MORROW

### SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

Type of Well:  
OIL WELL ☐ GAS WELL ☒ OTHER ☐

Name of Operator  
CONCHO RESOURCES INC.

Address of Operator  
110 W. LOUISIANA STE 410; MIDLAND TX 79701

Well Location  
Unit Letter K 1980 Feet From The SOUTH Line and 1650 Feet From The WEST Line  
Section 28 Township 23S Range 26E NMPM EDDY County

Elevation (Show whether DF, RKB, RT, GR, etc.)  
3346

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

#### NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

#### SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ANBANDONMENT ☒  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1/16/01 MIRU.  
1/17/01 ND WH & NU BOP. POH w/ tbg. RU cementers & circ hole w/ mud. Pumped 40 sx C cmt @ 3620-3374'. POH w/ tbg.  
1/18/01 RIH w/ WL & tag cmt @ 3363'. ND WH & NU BOP. RIH w/ tbg to 1937'. Pump 40 sx C cmt @ 1937-1691'.  
POH w/ tbg & WOC. Tagged cmt plug @ 1693'. POH w/ WL. RIH w/ tbg to 1334'. Load hole w/ mud, pump  
25 sx C cmt @ 1334-1180' per Mike Stubblefield. POH w/ tbg. RIH & cut csg @ 665'.  
1/19/01 POH w/ csg. RIH w/ tbg to 730'. Load hole & pump 60 sx C cmt @ 730'. POH w/ tbg & WOC. RIH w/ gauge ring &  
tagged cmt @ 492'. POH. RIH w/ tbg to 60' & pumped 20 sx C cmt 60' to surface. Install P&A marker.

RECEIVED  
OCD ARTESIA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Production Analyst DATE 03-09-01

TYPE OR PRINT NAME Terri Stathem TELEPHONE NO. 915-683-7443

(This space for State Use)

APPROVED BY  DATE 9-7-01

CONDITIONS OF APPROVAL, IF ANY: