

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division
811 S. 1st Street
Artesia, NM 88210-2834

APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals.

SUBMIT IN TRIPLICATE

1. Type of Well

Oil Gas
☒ Well ☐ Well ☐ Other

2. Name of Operator

STRATA PRODUCTION COMPANY

3. Address and Telephone No.

P. O. Box 1030
Roswell, New Mexico 88202-1030 505-622-1127

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FSL & 2310' FEL
Section 13-23S-29E

5. Lease Designation and Serial No.

NM-17589

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

Nash Unit

8. Well Name and No.

Nash Unit #29

9. API Well No.

30-015-29434

10. Field and Pool, or Exploratory Area

Nash Draw Brushy Canyon

11. County or Parish, State

Eddy County, New Mexico

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION	
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input type="checkbox"/> Subsequent Report	<input checked="" type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> OTHER _____	<input type="checkbox"/> Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. MIRU. ND wellhead. TOH with rods and pump. NU BOP. TOH with tubing.
2. Perforate 5 .42 holes at 5878'-5882'.
3. Acidize with 1000 gallons acid. Swab test and evaluate.
4. Frac with 4500 gallons gel and 3000# 16/30 sand. Swab test and evaluate.
5. Perforate 10 .42 holes at 5433'-5449'.
6. Acidize with 1500 gallons acid. Swab test and evaluate.
7. Frac with 4400 gallons gel and 3000# 16/30 sand. Swab test and evaluate.
8. TOH with tools. TIH with production string. ND BOP. Flange up wellhead.
9. TIH with pump and rods. Hang on. Start pumping. Release rig. RDMO.
10. Place on production.

14. I hereby certify that the foregoing is true and correct

Signed

Carol J. Garcia

Title Production Records Manager

Date 4/6/2001

(This space for Federal or State office use)

Approved by

(ORIG. SGD.) DAVID R. GLASS

Title

PETROLEUM ENGINEER

Date

APR 13 2001

Conditions of approval, if any:

