

BARCLAY STATE NO. 7

RUN 13-3/8" CASING

BAKER-LOK NOTCHED TEXAS PATTERN SHOE & COLLARS NO. 1, 2 & 3

TORQUE 48# CASING 2420 - 4030 ft-lbs

INSERT FLOAT VALVE INSIDE TOP OF JOINT NO. 1

1. Put stop ring and centralizer 5 ft. above notched Texas pattern shoe.
2. Put centralizer across Jt. No. 1 collar.
3. Put centralizers across Jt. No's. 4, 8, 12, 16 & 19 collars
4. Run 4 joints and install swage and pump thru insert float valve using rig pump.
5. Install swage when casing floats and break circulation with rig pump.
6. Tag TD and nipple up BJ Services.
7. Drop top wooden plug 'on the fly' and pump calculated displacement only.
8. Check for backflow. If backflow occurs, shut-in and WOC 6 hours.
9. WOC 6 hours after bumping plug before cutting off.