

UNITED STATES NM OIL CONS COMMISSION
DEPARTMENT OF THE INTERIOR DD
BUREAU OF LAND MANAGEMENT
ALBUQUERQUE, NM 88210

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Autry C. Stephens

3. Address and Telephone No.

110 N. Marienfeld, Suite 110; Midland, TX 79702 (915) 687-1994

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

3210' FNL 330' FEL Sec. 26
T-26-S, R-31-E

5. Lease Designation and Serial No.

LC 070869

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

White Federal #1

9. API Well No.

10. Field and Pool, or Exploratory Area

Mason, North (Delaware)

11. County or Parish, State

Eddy, N.M.

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Current: 8-5/8" csg. @ 878', cmt'd. w/ 325 sx, TOC @ surf
5-1/2" csg. @ 4128', cmt'd. w/ 125 sx, TOC @ 3175' (calc.)
Openhole to 4145', TD @ 4145'

Proposed procedure:

- 1) POOH w/ production equipment.
- 2) Set CIBP @ 4050'.
- 3) RIH w/ tbg. to 4050' and circulate mud (9.0 ppg water w/ 12.5#/bbl mud), pump 10 sx cmt. 4050-4000', POOH w/ tbg.
- 4) Recover +/- 3000' 5-1/2" csg., cut csg. based on stretch measurements.
- 5) RIH w/ tbg. and pump 40 sx "C" cmt. from 50' inside 5-1/2" stub to 50' above stub (+/- 3050-2950' depending on recovery), WOC and tag this plug.
- 6) POOH to 1400' and pump 35 sx "C" cmt. from 1400-1300' (freshwater sand).
- 7) POOH w/ tbg. to 928' and pump 45 sx "C" cmt. from 928-828' (surface casing shoe). [tag plug]
- 8) POOH w/ tbg. to 30' and pump 10 sx cmt. 30-3'. [use 50' plug]
- 9) Cut off wellhead 3' below G.L., cap well w/ plate, install dry hole marker.
- 10) Clean and level location.

14. I hereby certify that the foregoing is true and correct

Signed James F. Newman, P.E.

Title Agent

Date 10-12-94

(This space for Federal or State office use)

(ORIG. SGD.) JOE G. LARA

PETROLEUM ENGINEER

Approved by

Title

Date 10/18/94

Conditions of approval, if any:

See attached. Also tag plug across surface csg shoe & set 50' plug @ surface.

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.