


R-111-P AREA

Operator Texaco EXP, Inc.
 Well Cotton Draw Unit #65
 Unit G Section 2 Township 2S Range 31
 API # 30-015-10843

TOPS

Salade	956
B Salt	~ 4115
Delaware	4370
Bone Spring	8255
Wolfcamp	11628
Penn	13140
Strawn	13490
Atoka	13620
Meerow	14300
MISS	~ 15198
Siluro-Dou	~ 16350
Fusselman	~ 17220
Montoya	~ 17740
Ellenburger	~ 18788
Granite	~ 19546

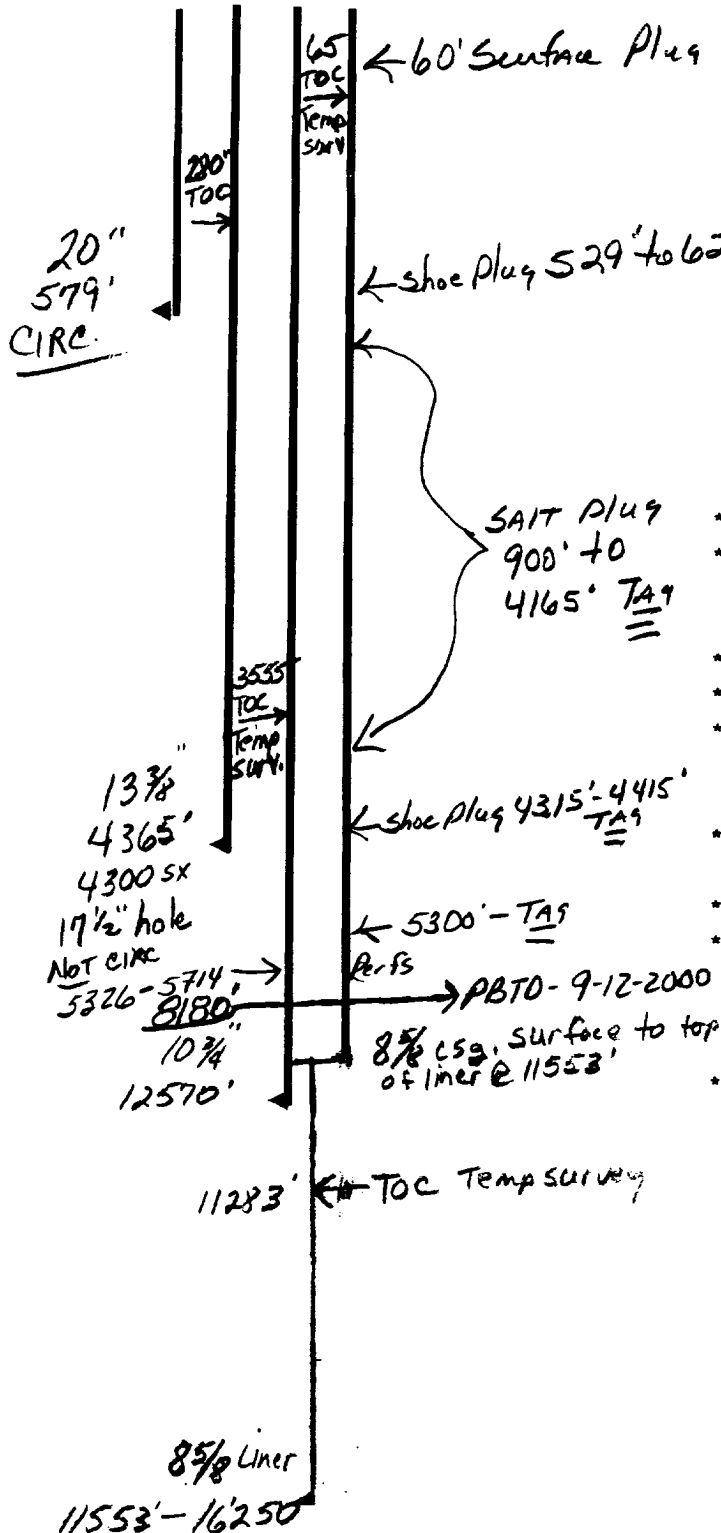

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.