


Well Abandonment Procedure

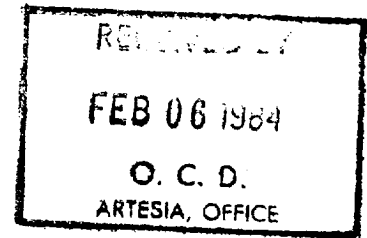

- 1) Call U.S.G.S. in Artesia @ (505) 746-9838, 24 hours prior to plugging well.
- 2) MIRU pulling unit. POH w/DH Equipment.
- 3) RIH w/CIBP and set @10,900'.
- 4) Spot 35' of cement on top of CIBP with 14 sxs.
- 5) Displace hole with 9.5# gel mud.
- 6) Spot 150' plug from 7950' to 7800' with 59 sxs.
- 7) Run free point to determine where 9-1/2" casing is free.
- 8) Cut casing above free point and pull approximately 4500' of 9-5/8" casing.
- 9) Spot a 300' plug from 4600' to 4300' with 204 sxs (based on casing cut @4500'). If casing cut is below 4550' or above 4350' spot an additional 100' plug (50' in, 50' outside casing cut with 61 sxs cmt).
- 10) Spot a 300' plug from 1000' to 700' with 250 sxs.
- 11) Spot a 50' plug from 50' to the surface w/41 sxs.
- 12) Cut casing off 3' below ground level and weld on steel plate with 4' marker above ground. Level cellar and location.