	UNITED STATES			RM APPROVED	
(JUNE 19 JO)	DEPARTM . OF T	HE INTERIO OIL CONS.	UVISIOn	ureau No. 1004-0135	i
	BUREAU OF LAND MANA	GEMENT & tot Street	Expire	s: March 31, 1993	L.
		Antopia NM 882	10.2824	tal No.	
5	UNDRY NOTICES AND REPO				
	Do not use this form for prop		6. If Indian, Allottee or Trib	e Name	
	or to deepen or reentry to a diff Use "APPLICATION FOR PERMIT-" fo				
			7. If Unit or CA, Agreement	Designation	
SUBMIT IN TRIPLICATE			Washington Ranch Storage Project		
1 Type of Well		x Other Gas Storage	8. Well Name and No.	N.I. Federal #9	
	Well Well		9. API Well No.		
1 Name of One	El Paso Natural Gas Co	mpany	-	0 - 015 - 23827	
3 Address and Telephone P.O. Box 2511, Houston, TX 77252-2511 713-420-2855			 Field and Pool, or Explo Washington R 		
			11. County or Parish, State		
 Location of Well (Footage, Sec., T., R., M., or Survey Description) 572' FEL & 1707' FNL S-33 T-25S R-24E 			Eddy Co., NM		
			<u> </u>	ΠΑΤΑ	
12. TYPE	OF SUBMISSION	INDICATE INATORE OF NOTICI	TYPE OF ACTION		
			<u> </u>		
	Notice of Intent	XAbandonment	Change of Pla		
			New Construction		
	Subsequent Report	Plugging Back	Non-Routine I Water Shut-Of	18	
		Casing Repair	Conversion to		
	Final Abandonment Notice		Dispose Wate	- C	
		Other	(Note: Report resu	ults of multiple completion on Well	27 1 4 4
1) 2) 3) 4) 5) 6) 7)	Moved in & rigged up pulling u Rigged up kill truck & killed we Removed wellhead & installed Released 2 7/8" tbg from packe Rigged up wireline truck & ran Pulled out of hole & rigged do Ran in hole with 2 7/8" tubing Rigged up mixer & rig pump &	ell with 9 #/gal brine. blowout preventer. er. Pulled out of hole with in hole w/ 4 1/2" CIBP on w wn wireline truck. to 6530'.	tubing & left standi		t j
8) 9) 10) 11) 12) 13) 14) 15) 16) 17)	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned ro Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su	5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 363 5.) & spotted 25 sx from 14(ped 56 sx from 901' to surfa- emaining (29 JTS.) tubing. Jumped 4 sx from 60' to surfa- a cleaned all equipment. rface equipment.	of CIBP from 6530'-()4' to 5129' (375').(Wo 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Sho	6485.(Bottom Plug) blfcamp Plug-Top @ 5438') ine Springs Plug-Top @ 3575') ierry Canyon Plug-Top @ 1407')	P+
9) 10) 11) 12) 13) 14) 15) 16) 17) 18)	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned re Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su Rigged up welder & set wellbo	ted 45' (3 sx Class C) on top 5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 36(5.) & spotted 25 sx from 14(ped 56 sx from 901' to surface emaining (29 JTS.) tubing. Imped 4 sx from 60' to surface a cleaned all equipment. rface equipment. ore location P&A marker.	of CIBP from 6530'-(04' to 5129' (375').(W 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Sho face.(Surface Plug)	6485.(Bottom Plug) bifcamp Plug-Top @ 5438') one Springs Plug-Top @ 3575') erry Canyon Plug-Top @ 1407') e Plug-Top Del @ 540' & Shoe @	P+
9) 10) 11) 12) 13) 14) 15) 16) 17) 18) 19)	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned re Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su Rigged up welder & set wellbo Cleaned up location & moved	ted 45' (3 sx Class C) on top 5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 363 5.) & spotted 25 sx from 14(ped 56 sx from 901' to surfa- emaining (29 JTS.) tubing. Imped 4 sx from 60' to surfa- cleaned all equipment. Inface equipment. pre location P&A marker. out.	of CIBP from 6530'-(04' to 5129' (375').(W 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Sho face.(Surface Plug)	6485.(Bottom Plug) blfcamp Plug-Top @ 5438') ine Springs Plug-Top @ 3575') ierry Canyon Plug-Top @ 1407')	P+
9) 10) 11) 12) 13) 14) 15) 16) 17) 18) 19)	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned ro Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su Rigged up welder & set wellbo Cleaned up location & moved	ted 45' (3 sx Class C) on top 5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 363 5.) & spotted 25 sx from 14(ped 56 sx from 901' to surfa- emaining (29 JTS.) tubing. Imped 4 sx from 60' to surfa- cleaned all equipment. Inface equipment. pre location P&A marker. out.	of CIBP from 6530'-(04' to 5129' (375').(W 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Sho face.(Surface Plug)	6485.(Bottom Plug) bifcamp Plug-Top @ 5438') one Springs Plug-Top @ 3575') erry Canyon Plug-Top @ 1407') e Plug-Top Del @ 540' & Shoe @	P+
9) 10) 11) 12) 13) 14) 15) 16) 17) 18) 19) 14 I hereby Signed	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned ro Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su Rigged up welder & set wellbo Cleaned up location & moved	ted 45' (3 sx Class C) on top 5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 363 5.) & spotted 25 sx from 14(ped 56 sx from 901' to surfa- emaining (29 JTS.) tubing. Imped 4 sx from 60' to surfa- cleaned all equipment. rface equipment. ore location P&A marker. out.	of CIBP from 6530'-(04' to 5129' (375').(Wo 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Sho face.(Surface Plug) (P&A d	6485.(Bottom Plug) olfcamp Plug-Top @ 5438') one Springs Plug-Top @ 3575') erry Canyon Plug-Top @ 1407') e Plug-Top Del @ 540' & Shoe @ late - 6/30/99) 26-JUI-99	} + → 826
9) 10) 11) 12) 13) 14) 15) 16) 17) 18) 19) 14. I hereby Signed (This space Approved	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned re Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su Rigged up welder & set wellbo Cleaned up location & moved certify that the foregoing is true and corre e for Federal or State office use)	ted 45' (3 sx Class C) on top 5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 363 5.) & spotted 25 sx from 14(ped 56 sx from 901' to surfa- emaining (29 JTS.) tubing. Imped 4 sx from 60' to surfa- cleaned all equipment. rface equipment. ore location P&A marker. out.	of CIBP from 6530'-(04' to 5129' (375').(Wo 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Sho face.(Surface Plug) (P&A d	6485.(Bottom Plug) olfcamp Plug-Top @ 5438') one Springs Plug-Top @ 3575') erry Canyon Plug-Top @ 1407') e Plug-Top Del @ 540' & Shoe @ late - 6/30/99) 26-Jul-99	<pre>/ +</pre>
9) 10) 11) 12) 13) 14) 15) 16) 17) 18) 19) 14. I hereby Signed (This space Approved	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned re Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su Rigged up welder & set wellbo Cleaned up location & moved certify that the foregoing is true and corre	ted 45' (3 sx Class C) on top 5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 14(ped 56 sx from 901' to surfi- emaining (29 JTS.) tubing. Imped 4 sx from 60' to surfi- a cleaned all equipment. rface equipment. ore location P&A marker. out. ct Title Principal Engr.	of CIBP from 6530'-(04' to 5129' (375').(Wo 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Sho ace.(Surface Plug) (P&A d	6485.(Bottom Plug) olfcamp Plug-Top @ 5438') one Springs Plug-Top @ 3575') erry Canyon Plug-Top @ 1407') e Plug-Top Del @ 540' & Shoe @ late - 6/30/99) 26-Jul-99	} + → 826
9) 10) 11) 12) 13) 14) 15) 16) 17) 18) 19) 14. I hereby Signed (This space Approved Condition	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned re Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su Rigged up welder & set wellbo Cleaned up location & moved certify that the foregoing is true and corre Cleaned up location & moved certify that the foregoing is true and corre Publed or State office use) by the for Federal or State office use) by Section 1001, makes it a crime for any person know	ted 45' (3 sx Class C) on top 5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 363 5.) & spotted 25 sx from 14(ped 56 sx from 901' to surfa- emaining (29 JTS.) tubing. Imped 4 sx from 60' to surfa- cleaned all equipment. Frace equipment. Frace equipment. Trace location P&A marker. out. Ct Title Title Title	of CIBP from 6530'-(04' to 5129' (375').(Wo 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Shoo ace.(Surface Plug) (P&A d 	6485.(Bottom Plug) bifcamp Plug-Top @ 5438') one Springs Plug-Top @ 3575') ierry Canyon Plug-Top @ 1407') e Plug-Top Del @ 540' & Shoe @ late - 6/30/99) 26-Jul-99 Image: AppRove Image: AppRove Image: AppRove Image: AppRove Image: AppRove Image: AppRove	₿÷
9) 10) 11) 12) 13) 14) 15) 16) 17) 18) 19) 14. I hereby Signed (This space Approved Condition	Mixed/pumped cement & spot Pulled up hole to 5504' (33 JTS Pulled up hole to 3638' (60 JTS Pulled up hole to 1461' (70 JTS Pulled to 901' (18 JTS.) & pum Pulled, laid down, & cleaned re Ran in hole w/ hose to 60' & pu Pulled out of hole with hose & Rigged down pulling unit & su Rigged up welder & set wellbo Cleaned up location & moved certify that the foregoing is true and corre Cleaned up location & moved certify that the foregoing is true and corre of public or State office use) by the for Federal or State office use)	ted 45' (3 sx Class C) on top 5.) & spotted 25 sx from 55(5.) & spotted 25 sx from 363 5.) & spotted 25 sx from 14(ped 56 sx from 901' to surfa- emaining (29 JTS.) tubing. Imped 4 sx from 60' to surfa- cleaned all equipment. Frace equipment. Frace equipment. Trace location P&A marker. out. Ct Title Title Title	of CIBP from 6530'-()4' to 5129' (375').(Wo 38' to 3263' (375').(Bo 61' to 1086' (375').(Ch ace.(Del/Surf-Csg-Shoo ace.(Surface Plug) (P&A d Date Date ment or agency of the United S Side	6485.(Bottom Plug) bifcamp Plug-Top @ 5438') one Springs Plug-Top @ 3575') ierry Canyon Plug-Top @ 1407') e Plug-Top Del @ 540' & Shoe @ late - 6/30/99) 26-Jul-99 Iates	₿÷

1 m	REAC	OF_{ij}	
1	2010		