

ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	
OPERATOR	<input checked="" type="checkbox"/>

OIL CONSERVATION DIVISION

P. O. BOX 2088 MAR 12 1984
SANTA FE, NEW MEXICO 87501

RECEIVED BY

C. C. D.

ARTESIA OFFICE

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease

State ☒

Fee ☐

5. State Oil & Gas Lease No.

L-6426

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER-

2. Name of Operator
DINERO OPERATING COMPANY

3. Address of Operator
POST OFFICE DRAWER 10505, MIDLAND, TEXAS 79702

4. Location of Well
UNIT LETTER B 660 FEET FROM THE NORTH LINE AND 1980 FEET FROM
THE EAST LINE, SECTION 32 TOWNSHIP 25-S RANGE 29-E N.M.P.M.

7. Unit Agreement Name

8. Farm or Lease Name

NORTHERN NATURAL GAS

9. Well No.

1

10. Field and Pool, or Wildcat

(WILDCAT) BONE SPRING

15. Elevation (Show whether DF, RT, GR, etc.)

2997.6 E.L.

12. County

Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPS. ☐
CASING TEST AND CEMENT JOBS ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☒

OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1503.

- Spotted 5 sacks Class C. with 2% CaCl at top of Bridge plug at 5,500 ft.
- Set plug (25 sacks Class C. with 2% CaCl) from 4690-4840' to cover perfs from 4754-4780'.
- Set plug (25 sacks Class C. with 2% CaCl) from 4455-4605' to cover perfs. from 4522-40'.
- Cut casing at 2850 ft. and pulled 4½" out of hole.
- Set plug (25 sacks Class C. with 2% CaCl) from 2150-2250'. (50' in 4½"-50' in 8 5/8" casing). WOC for 4 hours. Tag top of cement at 2765'.
- Set plug (27 sacks Class C. with 2% CaCl) from 1000'-1100'. WOC for 4 hours. Tag top of plug at 1012'.
- Set marker in 10 sacks Class C. at surface.

Post FD-2
3-16-82
P4A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Lavanda Norman

TITLE Production Supervisor

DATE 3/6/84

APPROVED BY Danell Moore

TITLE Geologist

DATE 2/26/86

CONDITIONS OF APPROVAL, IF ANY: