

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	✓
FILE	✓ ✓
U.S.O.S.	
LAND OFFICE	
OPERATOR	✓

P. O. BOX 2088
SANTA FE, RECEIVED BY 87501

FEB 25 1987

O. C. D.

ARTESIA, IOWA 51001

5a. Indicate Type of Lease

State **X**

Feb [

5. State Oil & Gas Lease No.

L-6708

SUPPLY NOTICES AND REPORTS/ARTESIA/10/2002
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO REDEVELOP EXISTING WELLS OR TO REPAIR OR REPLACE EXISTING WELLS. USE APPLICATION FOR PERMIT TO DRILL (STATE) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☒ GAS WELL ☐ OTHER-		7. Unit Agreement Name
2. Name of Operator Wood & Locker, Inc.		8. Farm or Lease Name Southland State
3. Address of Operator 505 N. Big Spring Suite 600 Midland, Texas 79701-8602		9. Well No. 1
4. Location of Well UNIT LETTER <u>H</u> <u>2080</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM <u>East</u> LINE, SECTION <u>1</u> TOWNSHIP <u>25-S</u> RANGE <u>27-E</u> NMPM.		10. Field and Pool, or Wildcat Wildcat - Bone Spring
15. Elevation (Show whether DF, RT, GR, etc.) 3092' GR, 3104' RKB		12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK	☐	PLUG AND ABANDON	☐	REMEDIAL WORK	☐	ALTERING CASING	☐
TEMPORARILY ABANDON	☐			COMMENCE DRILLING OPNS.	☐	PLUG AND ABANDONMENT	☒
PULL OR ALTER CASING	☐	CHANGE PLANS	☐	CASING TEST AND CEMENT JOBS	☐		
OTHER _____	☐			OTHER _____	☐		

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up unit, lay down rods, and pull tubing.
2. Rig up wireline truck and set C.I.B.P. @ 5940'. Cap with 5 sks. of cement.
3. Run in hole with tubing. Circulate hole with mud. Pull out of hole with tubing to 4500'
4. Spotted 25 sks. of cement @ 4500'.
5. Attempted to pull 4½" casing; shot @ 2150', 2065', 2022', and 1473'. Could not pull.
6. Run in hole with tubing to 2319' and spotted 100 sks. of cement. Pull out of hole with tubing and squeezed 10 bbls. in formation. Wait on cement.
7. Tagged plug @ 2100'. Spotted 50 sks. of cement.
8. Spotted 25 sks. of cement @ 350'.
9. Clean cellar; cut off wellhead; install P & A marker; cut off anchors.
10. Rig down unit and clean location.

Post ID-2
2-27-87
P+A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Dale May Dale May

Baber Well Servicing Co.
TITLE P & A Supervisor

DATE 2-20-87

APPROVED BY Samuel M. Hall

TITLE 1st Local

DATE 4/5/90

CONDITIONS OF APPROVAL, IF ANY: