

DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

NM-22207

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☐ other Gas Storage ☐
2. NAME OF OPERATOR  
El Paso Natural Gas Co. ✓
3. ADDRESS OF OPERATOR  
1800 Wilco Bldg., Midland, Tx 79701
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below)  
AT SURFACE: 1045' FSL & 512' FEL  
AT TOP PROD. INTERVAL:  
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐  
(other) ☐

SUBSEQUENT REPORT OF:

☐  
☐  
☐  
☒  
☐  
☐  
☐  
☐

RECEIVED BY

SEP 14 1984

O. C. D.

ARTESIA, OFFICE

6. INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Washington Ranch Storage Project

9. WELL NO.

12

10. FIELD OR WILDCAT NAME

Washington Ranch Morrow

11. SEC. T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 33, T-25-S, R-24-E

12. COUNTY OR PARISH

Eddy

13. STATE

N. Mex

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
GR 3748'

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

- 1.) Set tubing plug. RU and install 5000 psi hydraulic BOP.
- 2.) RU Snubbing unit, pull and lay down 2 7/8" production tubing.
- 3.) RU wireline unit and set Baker Model D permanent packer at 6750' wlm, with blanking plug below packer.
- 4.) Load 7" casing with water and pressure test to 3000 psig.
- 5.) Run 2 7/8" J-55 6.5# tubing with Baker E-22 latch in seal assembly, circulate inhibited packer fluid, latch into packer.
- 6.) Nipple down BOP, Nipple up wellhead.
- 7.) Pressure test tubing to 3000 psig. Retrieve blanking plug, return to service.

Subsurface Safety Valve: Manu. and Type

Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED

*[Signature]*

TITLE Area Prod. Eng.

DATE

9-10-84

ACCEPTED FOR RECORD

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY

TITLE

DATE

SEP 12 1984

*[Signature]*, NEW MEXICO

\*See Instructions on Reverse Side