STATE OF NEW MEXICU			
ENERGY AND MINERALS DEPARTMEN	T		
NO. OF CONICE ACCEIVED	IL CONSERVAT	F C 100	
DISTRIBUTION	P. O. BOX 2088		Form C-103 Revised 10-1-78
BANTAFE	SANTA FE, NEW MEXICO 87501		Reffice to this
FILE		RECEIVED BY	5a. Indicate Type of Lease
U.S.G.S.			State X Fee
LAND OFFICE		1111 9 5 100 4	5. State Oil & Gas Lease No.
OPERATOR		JUL 2 5 1984	
			LG 1171
SUNDRY	NOTICES AND REPORTS ON W	BLLS O. C. D.	
OO NOT USE THIS FORM FOR PROP USE "APPLICATIO	NOTICES AND REPORTS ON W	N TO A DEMARTESTARESERVOIA.	
1.	7. Unit Agreement Name		
OIL CAS	Flower Draw Unit 3		
2. Name of Operator	DTHER-		8. Farm or Lease Name
			Flower Draw Unit 3
Maddox Energy Corporat:	9. Well No.		
3. Address of Operator	2		
717 North Harwood Sui	10. Field and Pool, or Wildcat		
4. Location of Well			
UNIT LETTER I	Und. Bone Spring		
UNIT LITTLE			
East	н <u>3</u> токизнір <u>26-</u> S	28-E	AIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIII
THELINE, SECTION	TOKNSHIP	KANGE	<u></u>
mmmmmmm	12. County		
	Eddy		
	2951 KB 2937 GR		
^{16.} Check A	Appropriate Box To Indicate Na	ture of Notice, Report or (Other Data.
NOTICE OF IN		SUBSEQUE	NT REPORT OF:
PEAPORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
		COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT
TEMPORARILY ABANDON	CHANGE PLANS	CASING TEST AND CEMENT JOB	
PULL OR ALTER CASING	LRANGE PLAND	- Approximate and Approximate	
		OTHER	
OTHER	L L L L L		
	(Classic all participant data)	le and sine pertinent dates includ	ing estimated date of starting any proposed

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed wprk) SEE RULE 1903.

July 7, 1984 Drilled 7 7/8" hole to 6,500'. Run Open Hole Logs. Ran 161 joints of 4 ½", 10.50#, K-55, ST&C Casing and set at 6,500' with D.V. Tool at 4,334'. Cement thru Float Shoe at 6,500' (1st. Stage) with 225 Sacks Lite Cement followed by 275 Sacks Cl. "H" 50-50 Pozmix Cement, bumped plug with 800 psi., plug held OK. Opened D.V. Tool at 4,334', circulate out 40 Sacks of cement from first stage. Circulate hole for 4 hours. Cement second stage with 575 Sacks of Cl. "H" 50-50 Pozmix Cement, bumped plug with 1,000 psi. W.O.C. 120 Hours, Drilled out D.V. Tool and test casing to 4,000 psi, prep to start completion.

18. 1 hereby certify that the information above is true and complete	to the best of my knowledge and belief.	
18. I hereby certify that the information above is true and complete BIGNED	TITLE Agent	DATE July 24, 1984
APPROVED BY CONDITIONS OF APPROVAL, IF ANY: Supervisor District II	T 1TLE	JUL 27 1984