bmit 3 Copies Appropriate strict Office	State of New Me Ener, Ainerals and Natural Re	exico esources Department	Form C-103 Revised 1-1-89
STRICT I D. Box 1980, Hobbs, NM 88240OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088Strict II D. Drawer DD, Artesia, NM 88210Santa Fe, New Mexico 87504-2088		WELL API NO. 30-015-24836	
		5. Indicate Type of Lease STATE X FEE	
ISTRICT III 000 Rio Brazos Rd., Aziec, NM 87410			6. State Oil & Gas Lease No. LG-1171
	TICES AND REPORTS ON WEL	15	
DO NOT USE THIS FORM FOR PR	ICES AND RELOTED TO DEEPEN IOPOSALS TO DRILL OR TO DEEPEN RVOIR. USE "APPLICATION FOR PEI C-101) FOR SUCH PROPOSALS.)	OH FLUG DHOR TO A	7. Lease Name or Unit Agreement Name
Type of Well:	7	V	Flower AGA State
WELL X WELL	OTHER		8. Well No.
Name of Operator YATES PETROLEUM CORPO	RATION		- 1
Address of Operator			9. Pool name or Wildcat
105 South 4th St., Ar	tesia, NM 88210		Red Bluff Brushy Canyon
	80 Feet From The <u>South</u> Township 26S R	0.0 F) Feet From The East Line
Section 3	Township 205 R	r DF, RKB, RT, GR, etc.)	
	2937'	GR	
Check	Appropriate Box to Indicate	Nature of Notice, l	Report, or Other Data
	ITENTION TO:	SU	BSEQUENT REPORT OF:
	[]	REMEDIAL WORK	
	CHANGE PLANS		
		CASING TEST AND	
		OTHER.	
DTHER:	L		
/ 1 / (La) 1.			ciuding ASTIMATED DOLE OF SIGNARY BOOD STOR
12. Describe Proposed or Completed Op	verations (Clearly state all pertinent details,	and give periment dates, in	
12. Describe Proposed or Completed Op work) SEE RULE 1103.			新编辑 (1) 组织
12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI	OUS PAGE:	I Discol up M	ireline. TIH w/3-5/8" jet cutter
12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim	OUS PAGE: Nate free point at 2060 Ng. RIgged down wirelin	'. Rigged up w ne. Rigged up	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with Nippled up wellhead and BOP.
12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2	OUS PAGE: (nate free point at 2060) ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumped	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Clas	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Chut down for night.
12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir	OUS PAGE: nate free point at 2060 ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumped n 9-5/8" casing). POOH	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Clas with tubing.	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night.
<pre>12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tubing</pre>	OUS PAGE: nate free point at 2060 ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumped n 9-5/8" casing). POOH ubing and tagged top of	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Clas with tubing. cement at 1944	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. . Spotted 100 bbls plug mud
<pre>12 Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POC</pre>	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumper n 9-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Clas with tubing. cement at 1944 d down BOP and	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. ss C cement from 2050' (in 4-1/2" Shut down for night. . Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch
<pre>12 Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POC Welded on 8-5/8" put</pre>	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumped 19-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Clas with tubing. cement at 1944 d down BOP and asing jacks. H	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. ss C cement from 2050' (in 4-1/2" Shut down for night. . Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch r/7-1/2" jet cutter and cut
<pre>12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POO Welded on 8-5/8" put Estimate free point</pre>	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumper n 9-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c at 1150'. Rigged up w	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Clas with tubing. cement at 1944 d down BOP and asing jacks. H vireline. TIH w	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. .'. Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch w/7-1/2" jet cutter and cut cascing equipment. POOH with
12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POO Welded on 8-5/8" put Estimate free point 8-5/8" csing at 112!	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumper n 9-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c at 1150'. Rigged up w 5'. Rigged down wireli	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Clas with tubing. cement at 1944 d down BOP and asing jacks. H vireline. TIH w	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. .'. Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch v/7-1/2" jet cutter and cut casing equipment. POOH with . Nippled up BOP and wellhead.
12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POO Welded on 8-5/8" put Estimate free point 8-5/8" csing at 112!	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumper n 9-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c at 1150'. Rigged up w 5'. Rigged down wireli	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Clas with tubing. cement at 1944 d down BOP and asing jacks. H vireline. TIH w ne. Rigged up casing equipment ed 35 sacks Clas	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. . Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch v/7-1/2" jet cutter and cut casing equipment. POOH with t. Nippled up BOP and wellhead. ss C cement from 1175-1075'.
<pre>12 Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POO Welded on 8-5/8" put Estimate free point 8-5/8" csing at 1122 25 joints of 8-5/8" TIH with tubing to</pre>	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumper n 9-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c at 1150'. Rigged up w 5'. Rigged down wireli casing. Rigged down c 1175'. Mixed and pumpe	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Class with tubing. cement at 1944 d down BOP and asing jacks. H vireline. TIH w ne. Rigged up casing equipmented 35 sacks Class modeble. CO	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. .'. Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch v/7-1/2" jet cutter and cut casing equipment. POOH with t. Nippled up BOP and wellhead. ss C cement from 1175-1075'.
<pre>12 Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POO Welded on 8-5/8" put Estimate free point 8-5/8" csing at 1122 25 joints of 8-5/8" TIH with tubing to</pre>	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumper n 9-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c at 1150'. Rigged up w 5'. Rigged down wireli casing. Rigged down c 1175'. Mixed and pumpe	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Class with tubing. cement at 1944 d down BOP and asing jacks. H vireline. TIH w ne. Rigged up casing equipmented 35 sacks Class modeble. CO	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. .'. Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch v/7-1/2" jet cutter and cut casing equipment. POOH with t. Nippled up BOP and wellhead. ss C cement from 1175-1075'.
12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POO Welded on 8-5/8" pu Estimate free point 8-5/8" csing at 112! 25 joints of 8-5/8" TIH with tubing to I hereby certify that the information above is skonature	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumper n 9-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c at 1150'. Rigged up w 5'. Rigged down wireli casing. Rigged down c 1175'. Mixed and pumper is true and complete to the best of my knowledge	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Class with tubing. cement at 1944 d down BOP and asing jacks. H vireline. TIH w ne. Rigged up casing equipmented 35 sacks Class modeble. CO	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. .'. Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch v/7-1/2" jet cutter and cut casing equipment. POOH with t. Nippled up BOP and wellhead. ss C cement from 1175-1075'. NTINUED ON NEXT PAGE: n Clerk DATE July 12, 1995
 12. Describe Proposed or Completed Opwork) SEE RULE 1103. CONTINUED FROM PREVITIONS STREET STREE	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumper n 9-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c at 1150'. Rigged up w 5'. Rigged down wireli casing. Rigged down c 1175'. Mixed and pumper is true and complete to the best of my knowledge	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Class with tubing. cement at 1944 d down BOP and asing jacks. H vireline. TIH w ne. Rigged up casing equipmented 35 sacks Class modeble. CO	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. . Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch v/7-1/2" jet cutter and cut casing equipment. POOH with t. Nippled up BOP and wellhead. ss C cement from 1175-1075'.
12. Describe Proposed or Completed Op work) SEE RULE 1103. CONTINUED FROM PREVI Took stretch - estim and cut 4-1/2" casin 49 joints of 4-1/2" TIH with tubing to 2 casing) to 1950' (ir 7-6-95 - TIH with tu from 1940-400'. POO Welded on 8-5/8" pu Estimate free point 8-5/8" csing at 112! 25 joints of 8-5/8" TIH with tubing to I hereby certify that the information above is skonature	OUS PAGE: nate free point at 2060' ng. RIgged down wirelin casing. Rigged down ca 2050'. Mixed and pumped 19-5/8" casing). POOH ubing and tagged top of OH with tubing. Nipple 11 nipple. Rigged up c at 1150'. Rigged up w 5'. Rigged down wireli casing. Rigged down c 1175'. Mixed and pumped is true and complete to the best of my knowledge down ein	'. Rigged up w ne. Rigged up asing equipment d 25 sacks Class with tubing. cement at 1944 d down BOP and asing jacks. H vireline. TIH w ne. Rigged up casing equipment ed 35 sacks Class md belief. COT TIME Production	ireline. TIH w/3-5/8" jet cutter casing equipment. POOH with . Nippled up wellhead and BOP. s C cement from 2050' (in 4-1/2" Shut down for night. .'. Spotted 100 bbls plug mud wellhead. Rigged up welder. Pulled slips. Took casing stretch v/7-1/2" jet cutter and cut casing equipment. POOH with t. Nippled up BOP and wellhead. ss C cement from 1175-1075'. NTINUED ON NEXT PAGE: n Clerk July 12, 1995