MAYO MARRS CASING PULLING INC.

38-015-25260

BC OPERATING

Lease: HAY HOLLOW 25 STATE # 1

Project: P & A

3-27-02

MOVE IN ON LOCATION – GET SPOOL FROM CHANCE TOOL FOR BOP (3 HRS RIG)

03-28-02

NOTIFY OCD – VAN BARTON – MOVE 2 7/8" TUBING OFF LOCATION – JUNK – DIG WORKING PIT AND LINE – BLOW DOWN WELL SMALL AMOUNT OF CONDENSATE REST WATER - NUBOP & FLANGE - RIH WITH GAUGE RING TO 2523' – POOH - BEGIN IN HOLE WITH MMCPI WORKSTRING TO 2000' – CLOSE IN WELL (11 HRS RIG)

3-29-02

TAG TD @ 2523' – POOH – HAD CEMENT IN NOTCHED COLLAR – CALL VAN BARTON WITH NEW MEXICO OCD – RIH TO 60' – ESTABLISH INJECTION RATE OF 3 BBLS/MIN @ 50# - RIH WITH PACKER TO 2326' – TEST CASING TO 1000# FOR 30 MINUTES – POOH – OCD HAS AGREED TO LET US CUT CASING @ FREEPOINT AND SPOT STUB PLUG AND TAG - BEGIN BREAKING DOWN WELLHEAD – SHUT DOWN (11 HRS RIG)

4-01-02

OPEN WELL – NDBOP – BLOW DOWN GAS ON BACKSIDE – CUT LOOSE WELLHEAD BOLTS – COULD NOT BREAK – WELD ON PULL NIPPLE – NO STRETCH – CUT CASING @ 2292' – PRESSURE TEST TO 1000# WITH PACKER – CALL PHILL HAWKINS NMOCD – CUT OFF PULL NIPPLE – RIH & SPOT 50 SXS @ 2358'-2058' – POOH (12 HRS RIG)

4-02-02

RIH & TAG @ 2037' – POOH – WELD ON 7" PULL NIPPLE - RIH & CUT CASING @ 1492' – LAY DOWN CASING – CUT OFF 2" ABOVE COLLARS – THREAD AND COLLAR WERE GAULDING CUT 23 JOINTS – CLOSE IN WELL (10 HRS RIG)

4-03-02

LAY DOWN REST OF CASING –RIH & SPOT 100 SXS @ 1572' – WOC – RIH & TAG @ 1238' – CIR. MUD TO SURFACE – POOH & SPOT 40 SXS @ 598'-482' – POOH & SPOT 10 SXS @ 30' TO SURFACE – RIG DOWN – CUT OFF WLLHEAD AND ANCHORS – INSTALL DRY HOLE MARKER – MOVE OUT (9 HRS RIG)