

(November 1983)  
(Formerly 9-331)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE  
(Other instructions on re-  
verse side)

Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

NM - 57261

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

3. ADDRESS OF OPERATOR

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface

P, 505' FSL & 930' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3033.4 GR

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Picou Federal

9. WELL NO.

10. FIELD AND POOL, OR WILDCAT

Brushy Draw-Delaware

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

12. T-26-S, R-29-E

12. COUNTY OR PARISH 13. STATE

Eddy

New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Notify BLM @ (505) 887-6544, 24 hrs prior to beginning work.

- 1) MIRU PU. ND WH. NU BOP. POH w/pumping setup & prod. tbg. TIH w/CIBP, setting tool, & 2' Perf. Sub on 2-3/8" WS. Set CIPB @ 5700'. Spot 10 sx CL.'C' on top.
- 2) PU w/WS & displace hole w/9.5#/gal mud. PU w/WS to 3150'.
- 3) Spot 90 sx. CL.'C' cmt from 3150' to 2692'. PU w/WS to 2400'. TAG PLUG.
- 4) Spot 50 sx CL.'C' cmt from 2400' to 2250'. POH w/WS.
- 5) Work stretch on 9-5/8" csg. & cut csg. @ Freepoint. POH LD csg.
- 6) TIH w/WS & spot CL.'C' cmt plug. From 50' below csg. Cut to 100' above csg cut. TAG plug.
- 7) PU w/ WS to 710'. Spot 105 sx. CL.'C' cmt from 710' to ± 550'.
- 8) PU w/WS to 15'. Spot 7 sx. CL. 'C' cmt from 15' to 4'. POH.
- 9) RD. Cut off csg. 4' BGL. Weld on steel plate & dry hole marker. RR. Reclaim location.

18. I hereby certify that the foregoing is true and correct

SIGNED

*Maria L. Perez*

TITLE Proration Analyst

DATE 1-3-91

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

1-14-91

\*See Instructions on Reverse Side

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.