Submit 3 Copies

APPROVED BY -

State of New Mexico Energy Minerals and Natural Resources Department

Form C-103

District Office	Kevised 1-1-59
DISTRICT 1 P.O. Box 1980, Hobbs, NM 88240 OIL CONSERVATION DIVISION P.O. Box 2088	WELL API NO. 3001528002
DISTRICT II P.O. Drawer DD, Artesia, NM 88210 Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lease
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410	6. State Oil & Gas Lease No. VA - 0808
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name
1. Type of Well: OIL GAS WELL OTHER	Hoss State
Name of Operator Ronadero Co.	8. Well No. # 1
3. Address of Operator P.O. Box 430 Roswell, NM 88202-0430	9. Pool name or Wildcat San Lorenzo B.S.
4. Well Location Unit Letter I :1980 _ Feet From TheFSL Line and 66	O Feet From The FEL Line
Section 2 Township 25 S Range 28E	NMPM Eddy County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 2958 KB 2946 GL	
Check Appropriate Box to Indicate Nature of Notice, R NOTICE OF INTENTION TO: SUE	eport, or Other Data SSEQUENT REPORT OF:
ERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
EMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING	G OPNS. PLUG AND ABANDONMENT
ULL OR ALTER CASING CASING TEST AND C	EMENT JOB
THER: OTHER:	
 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, incluwork) SEE RULE 1103. 	
work) SEE RULE 1103. 1) set CIPB @ 4580' + 35' cmt 2) circ hole w/10# brine gell 3) cut 5 1/2 casing @ 2100' LD 57 1/2 JTS casing	Fost ID 5-15-92
1) set CIPB @ 4580' + 35' cmt 2) circ hole w/10# brine gell	Post ID 5-15-92 Prff
work) SEE RULE 1103. 1) set CIPB @ 4580' + 35' cmt 2) circ hole w/10# brine gell 3) cut 5 1/2 casing @ 2100' LD 57 1/2 JTS casing 4) spot plugs @ follows: a) 2672-2419 25sxs "C"+ 3% CACL* Tagged @ 2498' b) 2144 - 1987 35sxs "C" + 3% CACL* Tagged @ 199 c) 559-448' 35sxs "C" neat	Fost 3D 5-15-92 Frf
**************************************	Post ID 5-15-92 Prff
1) set CIPB @ 4580' + 35' cmt 2) circ hole w/10# brine gell 3) cut 5 1/2 casing @ 2100' LD 57 1/2 JTS casing 4) spot plugs @ follows: a) 2672-2419 25sxs "C" + 3% CACL* Tagged @ 2498' b) 2144 - 1987 35sxs "C" + 3% CACL* Tagged @ 199 c) 559-448' 35sxs "C" neat d) 30'-surface 10 sxs "C" neat Installed marker, clean location, level pits.	Post ID 5-15-98 Post ID For A Presidence of the second of
**************************************	Post ID 5-15-92 Prff