

**Inkling 8 Federal No. 1
Phantom Draw (Delaware) Field
Eddy County, New Mexico**

Project Engineer: **Jack R. Gevecker**

Office (915) 688-6982
Residence (915) 682-0100

Recommended Procedure

Note: H2S may be present

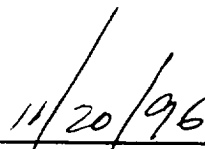
Perform job safety analysis prior to start of work

1. MIRU pulling unit. Install and test BOP. Unseat packer and POOH w/ packer and 2-7/8" tubing.
2. RU wireline company and packoff. GIH w/ 5-1/2" CIBP and set @ +/- 6750'. Cap w/ 35' cement using a dump bailer.
3. GIH w/ 5-1/2" chemical cutter and cut off casing @ +/- 5850'. POOH and lay down 5-1/2" casing.
4. GIH w/ 2-7/8" tubing open ended to +/- 5925'. Circulate hole w/ 10 ppg mud laden fluid. Spot 25 sx Class C cement plug across 5-1/2" casing stub from 5925' to 5800'.
5. Pick up tubing to 3925'. Spot 30 sx Class C cement plug across 8-5/8" casing shoe from 3925' to 3810'.
6. Pick up tubing to +/- 1020'. Spot 30 sx Class C cement plug across surface pipe shoe from 1020' to 900'.
7. Pick up tubing to +/- 100'. Spot 30 sx Class C cement plug from 100' to surface.
8. Cut off casing 3' below surface. Weld steel plate on casing stub. Restore location as directed.

Approved: _____


Hal A. Lee

Date: _____


11/20/96