UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT

		Sundry Not	ices and Repo	rts on Wel.	LsEIVEL		
T	ype of Wel	1			18 PM 2 : I	6.	Lease Number NMSF-078115 If Indian, All. or Tribe Name
						7.	Unit Agreement Nam
E	BURLING RESCU		COMPANY LP			8.	Well Name & Number
		hone No. of Opera 9, Farmington, NM		326-9700		9.	Grenier #20 API Well No.
		Well, Footage, S 770'FWL, Sec.6, T		, NMPM			30-045-20499 Field and Pool Basin Fruitland Co County and State San Juan Co, NM
		·					
		OPRIATE BOX TO IN	DICATE NATURE	OF NOTICE	, REPORT,	OTHER	DATA
T	ype of Sub			Type of Act			
	Not	ice of Intent	_X_ Abandon		Change		
	V Sub	sequent Report	Recomple Plugging		New Con		non Fracturing
	X Sub	seduciic veboic					_
			Casing 1	Repair	Water S	nui oi	
	Fin	al Abandonment	Casing I		Water Si Convers		Injection
	Fin	al Abandonment					
			Altering Other -	g Casing _			
•	Describe	Proposed or Comp	Altering Other -	g Casing	Convers	ion to	o Injection
•	Describe 2-18-04	Proposed or Composition MIRU. ND WH. NU existing cmt re Establish circ w	Altering Other -	OK. TOOH W,O'. SDON.	Convers /97 jts 2	3/8" t	b Injection tbg. TIH, tag "B" neat cmt
•	Describe 2-18-04 2-19-04	Proposed or Composition MIRU. ND WH. NU existing cmt re Establish circ w inside csg @ 21 Coal perfs. WOO	Altering Other - leted Operation BOP. PT BOP, Operation of the state	OK. TOOH W.O'. SDON. Plug #1: pu	Convers	3/8" t	by Injection tbg. TIH, tag "B" neat cmt & fill Fruitland
•	Describe 2-18-04	Proposed or Composition MIRU. ND WH. NU existing cmt re Establish circ w inside csg @ 22 Coal perfs. WOO Load csg w/9 bbl TOOH to 1438'. inside csg @ 12	Altering Other - Other	Casing Casing Cons OK. TOOH WAND STOOM. Plug #1: pure prover Picture for 500 pside for Plug #2 prover Kirtle	Convers. /97 jts 2 ump 67 sx or defined Cliffs /15 min, 00 2: pump 16 and & Ojo	3/8" t Class s top K. TIF sx Cl Alamo	"B" neat cmt & fill Fruitland H, tag TOC @ 2258'. ass "B" neat cmt tops. WOC. TOOH.
•	Describe 2-18-04 2-19-04	Proposed or Comp. MIRU. ND WH. NU existing cmt re Establish circ w inside csg @ 2: Coal perfs. WOO Load csg w/9 bbl TOOH to 1438'. inside csg @ 1: Establish circ Load hole w/12 circ down csg @	Altering Other - Other	CASING CASING CONSTRUCTION CONSTRUCT PICTURE COVER FITTE COVER KITTLE	Convers. /97 jts 2 ump 67 sx ored Cliffs /15 min, 0 2: pump 16 and & Ojo ead w/16 bb uz holes @ #3: pump 16	3/8" t Class s top K. TIF sx Cl Alamo ol wtr 159'.	"B" neat cmt & fill Fruitland H, tag TOC @ 2258'. ass "B" neat cmt tops. WOC. TOOH. TOOH. TOOH. Establish Class "B" neat cmt
•	Describe 2-18-04 2-19-04	MIRU. ND WH. NU existing cmt re Establish circ w inside csg @ 2: Coal perfs. WOO Load csg w/9 bbl TOOH to 1438'. inside csg @ 1: Establish circ Load hole w/12 circ down csg & down 4 ½" csg & Wade, BLM on lo	Altering Other - Other	Casing Casing Cons OK. TOOH W. O'. SDON. Plug #1: pu cover Pictu to 500 psi to 500 psi to Flug #2 cover Kirtl t bradenhe perf 3 sc ead. Plug #2 cover Weekend TOOH. Nu sg, annulus	Convers. /97 jts 2 ump 67 sx or collection of the collection of	3/8" to Class top K. TIF sx Cl Alamool wtr 159'. 00 sx to sur	"B" neat cmt & fill Fruitland H, tag TOC @ 2258'. ass "B" neat cmt tops. WOC. TOOH. TOOH. Establish Class "B" neat cmt face. WOC. (Mike
•	Describe 2-18-04 2-19-04 2-20-04	MIRU. ND WH. NU existing cmt re Establish circ w inside csg @ 2: Coal perfs. WOO Load csg w/9 bbl TOOH to 1438'. inside csg @ 12 Establish circ Load hole w/12 circ down csg @ down 4 ½" csg @ Wade, BLM on lo TIH, tag TOC in "B" neat cmt to	Altering Other - Other	Casing Casing Cons OK. TOOH W. O'. SDON. Plug #1: pu cover Pictu to 500 psi to 500 psi to Flug #2 cover Kirtl t bradenhe perf 3 sc ead. Plug #2 cover Weekend TOOH. Nu sg, annulus	Convers. /97 jts 2 ump 67 sx or collection of the collection of	3/8" to Class top K. TIF sx Cl Alamool wtr 159'. 00 sx to sur	"B" neat cmt & fill Fruitland H, tag TOC @ 2258'. ass "B" neat cmt tops. WOC. TOOH. TOOH. Establish Class "B" neat cmt face. WOC. (Mike
	Describe 2-18-04 2-19-04 2-20-04 2-23-04 Well plu	MIRU. ND WH. NU existing cmt re Establish circ w inside csg @ 2: Coal perfs. WOO Load csg w/9 bbl TOOH to 1438'. inside csg @ 12 Establish circ Load hole w/12 circ down csg down 4 ½" csg & Wade, BLM on lo TIH, tag TOC in "B" neat cmt to (Mike Wade, BLM	Altering Other - leted Operation BOP. PT BOP, (1) etainer @ 3050 (1) /40 bbl wtr. 11 184-3050' to compose to compose the compose of the com	Casing Casing Cons OK. TOOH W. O'. SDON. Plug #1: pure cover Picture. Too 500 psixing to 500	Convers. /97 jts 2 ump 67 sx 6 red Cliffs /15 min, 0 2: pump 16 and & Ojo ead w/16 bk gz holes @ 3: pump 10 bbl cmt to bbl cmt to i. J BOP. Cut s & install released.	3/8" to Class top K. TIF sx Cl Alamool wtr 159'. 00 sx to sur	"B" neat cmt & fill Fruitland H, tag TOC @ 2258'. ass "B" neat cmt tops. WOC. TOOH. TOOH. Establish Class "B" neat cmt face. WOC. (Mike WH. Pump 24 sx Class hole marker.
	Describe 2-18-04 2-19-04 2-20-04 2-23-04 Well plu I hereby	MIRU. ND WH. NU existing cmt re Establish circ w inside csg @ 2: Coal perfs. WOO Load csg w/9 bbl TOOH to 1438'. inside csg @ 12 Establish circ Load hole w/12 circ down csg down 4 ½" csg & Wade, BLM on lo TIH, tag TOC in "B" neat cmt to (Mike Wade, BLM)	Altering Other - leted Operation BOP. PT BOP, Operation etainer @ 3050 /40 bbl wtr. 11 184-3050' to complete the complete to complete the compl	Casing Casing Cons OK. TOOH W. O'. SDON. Plug #1: pure cover Picture. Too 500 psizer. Plug #2 Toover Kirtle bradenher perf 3 scend. Plug #2 Ead. Plug #2 Ead. Plug #2 Ead. Circ 1 Eor weekend TOOH. Number of the cover Right of the co	Convers. /97 jts 2 ump 67 sx ored Cliffs /15 min, 00 2: pump 16 and & Ojo ead w/16 bit gz holes @ #3: pump 16 bbl cmt fil J BOP. Cut s & install released.	3/8" to Class top K. TIF sx Cl Alamod wtr 159'. 00 sx to sur off W dry	"B" neat cmt & fill Fruitland H, tag TOC @ 2258'. ass "B" neat cmt tops. WOC. TOOH. TOOH. Establish Class "B" neat cmt face. WOC. (Mike WH. Pump 24 sx Class hole marker.
, anis	Describe 2-18-04 2-19-04 2-20-04 2-23-04 Well plu I hereby	MIRU. ND WH. NU existing cmt re Establish circ we inside csg @ 2: Coal perfs. WOO Load csg w/9 bbl TOOH to 1438'. inside csg @ 12 Establish circ Load hole w/12 circ down csg @ down 4 ½" csg @ Wade, BLM on lo TIH, tag TOC in "B" neat cmt to (Mike Wade, BLM) gged and abandoned	Altering Other - leted Operation BOP. PT BOP, (1) etainer @ 3050 (1) /40 bbl wtr. 1 /40 bbl wtr. 5 /40 bbl wtr. 5 /40 bbl wtr. TOOH. SDON. wtr. PT csg for the second of	Casing Casing Cons OK. TOOH W. O'. SDON. Plug #1: pure cover Picture. Too 500 psizer. Plug #2 Toover Kirtle bradenher perf 3 scend. Plug #2 Ead. Plug #2 Ead. Plug #2 Ead. Circ 1 Eor weekend TOOH. Number of the cover Right of the co	Convers. /97 jts 2 ump 67 sx ored Cliffs /15 min, 00 2: pump 16 and & Ojo ead w/16 bit gz holes @ #3: pump 16 bbl cmt fil J BOP. Cut s & install released.	3/8" to Class stop K. TIF sx Cl Alamo of wtr 159'. 00 sx to sur off W dry	"B" neat cmt fill Fruitland H, tag TOC @ 2258'. ass "B" neat cmt tops. WOC. TOOH. TOOH. Establish Class "B" neat cmt face. WOC. (Mike WH. Pump 24 sx Class hole marker.

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdictian 19 2004

FARMINGTON FIELD OFFICE