Form 3160-5 (August 1999)

## INITED STATES

UNITED SAATES				
DEPARTMENT OF THE INTERIOR				
BUREAU OF LAND MANAGEMENT				

OME	3 NO. 1004	-0135
Expires:	November	30, 200
Lanca Carial Ma		

FORM APPROVED

	DEALLOST AND MANA		Expires: N	ovember 30, 2000		
BUREAU OF LAND MANAGEMENT  SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an			5. Lease Serial No. NMNM013860.			
abandoned wel	abandoned well. Use form 3160-3 (APD) for such proposals.			or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on reverse side.			7. If Unit or CA/Agr NMNM73518	eement, Name and/or No.		
Type of Well     Oil Well			8. Well Name and No RUSSELL LS 4	).		
2. Name of Operator BP AMERICA PRODUCTION				00-S1		
3a. Address P. O. BOX 3092 HOUSTON, TX 77253	P. O. BOX 3092 Ph: 281.366.4491			r Exploratory AVERDE		
4. Location of Well (Footage, Sec., T	, R., M., or Survey Description	1)	11. County or Parish	, and State		
Sec 24 T28N R8W SWNE 150 36.65006 N Lat, 107.62854 W			SAN JUAN CC	DUNTY, NM		
12. CHECK APPE	ROPRIATE BOX(ES) T	O INDICATE NATURE OF N	NOTICE, REPORT, OR OTHI	ER DATA		
TYPE OF SUBMISSION		ТҮРЕ О	FACTION			
Notice of Intent	☐ Acidize	□ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off		
_	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	■ Well Integrity		
☐ Subsequent Report	☐ Casing Repair	■ New Construction	□ Recomplete	<b>⊠</b> Other		
☐ Final Abandonment Notice	☐ Change Plans	□ Plug and Abandon	☐ Temporarily Abandon	Workover Operations		
	☐ Convert to Injection	☐ Plug Back	■ Water Disposal			
13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)						
BP America Production Comp Menefee formation within the	any respectfully request Mesaverde Pool as per t	permission to add pay and stir ne attached procedure.	JAN 2003 OIL COLORS	N. S.		

14. I hereby certify tha	For BP AMERICA PRO	verified by the BLM Well Information System DUCTION CO, sent to the Farmington by Matthew Halbert on 01/21/2003 (03MXH0373SE)	·
Name (Printed/Type	d) MARY CORLEY	Title AUTHORIZED REPRESENTATIVE	
Signature	(Electronic Submission)	Date 11/21/2002	
	THIS SPACE FOR FE	DERAL OR STATE OFFICE USE	
Approved By	im Lovate	Title	JAN 22 2003

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Office Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.



## Russell LS #4


T28N-R8W-Sec24 API#: 30-045-07319

## Procedure:

- 1. Check anchors. MIRU workover rig.
- 2. If necessary, kill with 2% KCL water. Nipple down WH. NU BOPs.
- 3. Tag for fill and tally OH with 2-3/8" production tubing currently set at 5121'. Visually inspect tbg while POOH.
- 4. TIH with bit and 7-5/8" casing scraper to 2932' and 5-1/2" casing scraper to 4954'.
- 5. RIH with 5-1/2" CIBP. Set CIBP at 4934'.
- 6. RIH with GR log. Log Menefee interval.
- 7. RIH with casing guns. Perforate Menefee formation (correlate to GR log).
- 8. RIH with frac string and 5-1/2" packer.
- 9. RU frac equipment. Use 2% KCL-N2 foam in fracture stimulation.
- 10. Frac Menefee according to pump schedule.
- 11. Flowback frac fluid immediately.
- 12. Release PKR and POOH with frac string.
- 13. TIH with tubing and bit. Cleanout fill and drill bridge plug set at 4934'. Cleanout fill to PBTD at 5150'. Blow well dry at PBTD.
- 14. Land 2-3/8" production tubing at 5121'.
- 15. ND BOP's. NU WH. Test well for air. Return well to production.

## **Russell LS 4**

Sec 24, T28N, R8W API #: 3004507319

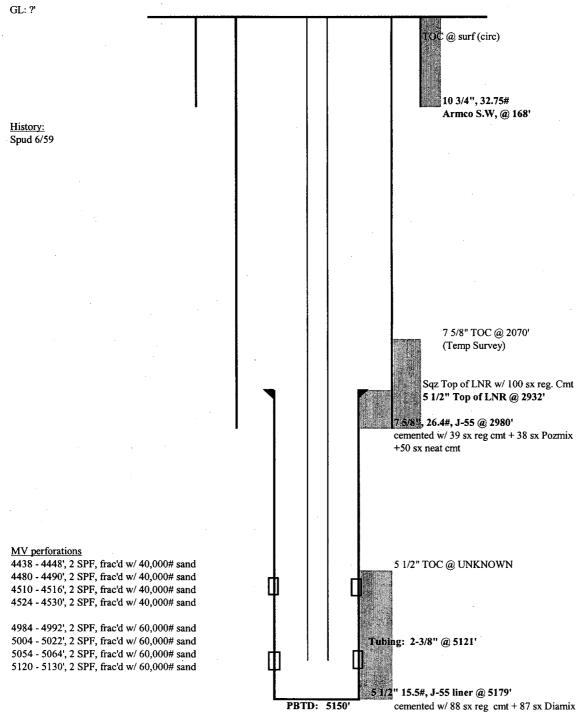

TD: 5181'