submitted in lieu of Form 3160-5

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

RECEIVED

Will Agreement Name 2. Name of Operator Hart Oil & Gas, Inc. 3. Address & Phone No. of Operator PO Box 307, Farmington, NM 87499 (505) 326-1163 Location of Well, Footage, Sec., T, R, M 10. Field and Pool Horseshoe Gallup 1980' FSL and 1980' FEL, Section 9, T-31-N, R-17-W, 11. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA Type of Submission Type of Action Notice of Intent Abandonment Plugging Back Casing Repair Plugging Back Conversion to Injection Altering Casing Conversion to Injection 13. Describe Proposed or Completed Operations Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8' workstring and TiH. Tag at 912'. Establish circulation out the 5' casing with 25 bbls water. Plug #1 with 56 ses cement with 2% CaCl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5' casing and down 8' in 7-5/8' annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Title Vice President Date 17the Date 17the Date	A	REAU OF LAND MAI undry Notices and Re		M II: 35
2. Name of Operator Hart Oil & Gas, Inc. 3. Address & Phone No. of Operator PO Box 307, Farmington, NM 87499 (505) 326-1163 2. Name of Well, Footage, Sec., T, R, M Location of Well, Footage, Sec., T, R, M 1980' FSL and 1980' FEL, Section 9, T-31-N, R-17-W, 11. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA Type of Submission Type of Action Notice of Intent A Abandonment Recompletion New Construction Notice of Intent A Casing Repair Water Shut off Final Abandonment Altering Casing Conversion to Injection Other 13. Describe Proposed or Completed Operations Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8' workstring and TiH. Tag at 912'. Establish circulation out the 5' casing with 25 bbls water. Plug #I with 56 sxs cement with 2% CacIC inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, CK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5' casing from 88' to surface, circulate good cement out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5' casing and down 8' in 7-5/8' annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Gina Sajied Title Vice President Date Date	••		6 7 8 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9	14-20-603-2034 . If Indian, All. or
Address & Phone No. of Operator PO Box 307, Farmington, NM 87499 (505) 326-1163 Location of Well, Footage, Sec., T, R, M 1980' FSL and 1980' FEL, Section 9, T-31-N, R-17-W, 11. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA Type of Submission Notice of Intent Recompletion Notice of Intent Recompletion New Construction New Construction New Construction New Construction New Construction New Construction Non-Routine Fracturing Casing Repair Water Shut off Courte Casing Repair Water Shut off Conversion to Injection Other - 13. Describe Proposed or Completed Operations Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8' workstring and TiH. Tag at 912'. Establish circulation out the 5' casing with 25 bbls water. Plug #I with 56 sxs cement with 2% Cacl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubinja. Shut in well and WOC. Pressure test casing to 500%, CK, RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5' casing from 88' to surface, circulate good cement out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5' casing and down 8' in 7-5/8' annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Gina Sajied (This space for Federal or State Office use) APPROVAL if any.			APR 2000	. Unit Agreement Name
Location of Well, Footage, Sec., T, R, M 1980' FSL and 1980' FEL, Section 9, T-31-N, R-17-W, 11. County & State San Juan County, NM 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA Type of Submission Type of Action Notice of Intent A Abandonment Recompletion Non-Routine Fracturing Casing Repair Casing Repair Pinal Abandonment Altering Casing Other 13. Describe Proposed or Completed Operations Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8' workstring and TiH. Tag at 912'. Establish circulation out the 5' casing with 25 bbls water. Plug #1 with 56 sxs cement with 2% CaCl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5' casing from 99' to surface, circulate good cement out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5' casing and down 8' in 7-5/8' annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Gina Seled Title Vice President Date Date	3. Address & Phone No. of Operato		8	Navajo TI "F" #115 . API Well No.
1980' FSL and 1980' FEL, Section 9, T-31-N, R-17-W, 11. County & State San Juan County, NM 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA Type of Submission Notice of Intent X. Abandonment Recompletion New Construction Non-Routine Fracturing Casing Repair Water Shut off Altering Casing Conversion to Injection 13. Describe Proposed or Completed Operations Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8' workstring and TiH. Tag at 912'. Establish circulation out the 5' casing with 25 bbls water. Plug #1 with 56 sxs cement with 2% CaCl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500%, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5' casing from 98' to surface, circulate good cement out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5' casing and down 8' in 7-5/8" annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Gina Selied Title Vice President Date Date	Location of Well, Footage, Sec., T, R	, M		0. Field and Pool
Type of Submission Notice of Intent Abandonment Recompletion New Construction Non-Routine Fracturing Water Shut off Altering Casing Repair Altering Casing Conversion to Injection Other - 13. Describe Proposed or Completed Operations Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8" workstring and TIH. Tag at 912'. Establish circulation out the 5" casing with 25 bbls water. Plug #1 with 56 sxs cement with 2% CaCl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5" casing from 98' to surface, circulate good cement out bradenhead. Shut in well. 2-2-3-04 Cut off wellhead and found cement down 4' in 5" casing and down 8' in 7-5/8" annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Gina Spied Title Vice President Date Date CONDITION OF APPROVAL if any:	1980' FSL and 1980' FEL, Section	9, T-31-N, R-17-W,	1	
Notice of Intent Recompletion New Construction Non-Routine Fracturing Water Shut off Casing Repair Altering Casing Other - 13. Describe Proposed or Completed Operations Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8" workstring and TiH. Tag at 912'. Establish circulation out the 5" casing with 25 bbls water. Plug #1 with 56 sxs cement with 2% CaCi2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5" casing from 98' to surface, circulate good cement out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5" casing and down 8' in 7-5/8" annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Title Vice President Date 3/15/04 (This space for Federal or State Office use) APPROVED BY Title Date CONDITION OF APPROVAL if any:			OF NOTICE, REPORT, OTHER	R DATA
Casing Repair Altering Casing Other - 13. Describe Proposed or Completed Operations Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8" workstring and TiH. Tag at 912'. Establish circulation out the 5" casing with 25 bbls water. Plug #1 with 56 sxs cement with 2% CaCl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5" casing from 98' to surface, circulate good cemend ub radenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5" casing and down 8' in 7-5/8" annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Gina Selied Title Vice President Date Date CONDITION OF APPROVAL if any:	Notice of IntentX	Abandonment Recompletion	New Construction	
Hart Oil & Gas plugged and abandoned this well on February 23, 2004. 2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8" workstring and TiH. Tag at 912'. Establish circulation out the 5" casing with 25 bbls water. Plug #1 with 56 sxs cement with 2% CaCl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5" casing from 98' to surface, circulate good cement out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5" casing and down 8' in 7-5/8" annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Gina Salied Title Vice President Date Date CONDITION OF APPROVAL if any:		Casing Repair Altering Casing	Water Shut off	
2-19-04 MO & RU. NU BOP and test. Shut in well. 2-20-04 PU 29 joints 2-3/8" workstring and TiH. Tag at 912'. Establish circulation out the 5" casing with 25 bbls water. Plug #1 with 56 sxs cement with 2% CaCl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5" casing from 98' to surface, circulate good cement out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5" casing and down 8' in 7-5/8" annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Title Vice President Date 3/15/04 CThis space for Federal or State Office use) APPROVED BY Date Date CONDITION OF APPROVAL if any:	13. Describe Proposed or Completed			
2-20-04 PU 29 joints 2-3/8" workstring and TIH. Tag at 912'. Establish circulation out the 5" casing with 25 bbls water. Plug #1 with 56 sxs cement with 2% CaCl2 inside the casing from 922' to 259' to isolate the Gallup perforations. TOH and LD tubing. Shut in well and WOC. Pressure test casing to 500#, OK. RIH wireline and tag cement at 399'. Perforate 2 holes at 98'. Establish circulation out bradenhead with 6 bbls of water. Plug #2 with 41 sxs cement pumped down the 5" casing from 98' to surface, circulate good cement out bradenhead. Shut in well. 2-23-04 Cut off wellhead and found cement down 4' in 5" casing and down 8' in 7-5/8" annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed Title Vice President Date 3/15/04 CThis space for Federal or State Office use) APPROVED BY Title Date CONDITION OF APPROVAL if any:	Hart Oil & Gas plugged and	abandoned this we	ell on February 23, 2004.	
2-23-04 Cut off wellhead and found cement down 4' in 5" casing and down 8' in 7-5/8" annulus. Mix 20 sxs cement to fill casing and annulus, then install P&A marker. RD and MOL. W. Ashley, Navajo Nation Minerals and B. Freeman Navajo EPA were on location. 14. I hereby certify that the foregoing is true and correct. Signed	2-20-04 PU 29 joints 2-3/8" workstring and Plug #1 with 56 sxs cement with 2 TOH and LD tubing. Shut in well a 399'. Perforate 2 holes at 98'. Es	TiH. Tag at 912'. Est % CaCl2 inside the case and WOC. Pressure te tablish circulation out the table.	sing from 922' to 259' to isolate the est casing to 500#, OK. RIH wirelin oradenhead with 6 bbls of water. P	e Gallup perforations. ne and tag cement at rlug #2 with 41 sxs
Signed Title Vice President Date 3/15/04	2-23-04 Cut off wellhead and found cemen casing and annulus, then install Po	nt down 4' in 5" casing a &A marker. RD and MC	and down 8' in 7-5/8" annulus. Mix DL.	
Gina Sajied (This space for Federal or State Office use) APPROVED BY Title Date CONDITION OF APPROVAL if any:	14. I hereby certify that the foregoing	g is true and correc	L.	
APPROVED BY Title Date Date	Signed One Oared Gina Saied	Title Vic	e President	Date <u>3/15/04</u>
CONDITION OF APPROVAL, if any:	APPROVED BY			Date
	CONDITION OF APPROVAL, if any:			TO PECO

.PR 0 / 2004

MMOCD