Submit 3 Copies to Appropriate District Office

State of New Mexico --Energy, Minerals and Natural Resources Departmen

Form C-103 Revised 1-1-89

DISTRICT I OIL CONSERVATION DIVISION WELL API NO. P.O. Box 1980, Hobbs, NM 88240 2040 Pacheco St. 30-045-2468/1 DISTRICT II 5. Indicate Type of Lease Santa Fe, NM 87505 P.O. Drawer DD, Artesia, NM 88210 STATE FEE 6. State Oil & Gas Lease No. DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 NM LG1304-2 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PORPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name State of New Mexico DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS) 1. Type of Well: South Blanco State WELL X WELL OTHER MAR 2002 2. Name of Operator 36-2 Elm Ridge Resources, Inc. Pool name or Wildcat 3. Address of Operator 1356. 3 30 Lybrook Gallup PO Box 189 Farmington, NM 87499 4. Well Location 660 East Feet From The Feet From The Line Unit Letter H 2310 North ine and Range 8W **NMPM** Rio Arriba County **Township** 24N Section 36 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 6930' GR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data SUBSEQUENT REPORT OF: **NOTICE OF INTENTION TO:** $|\mathbf{x}|$ **ALTERING CASING** PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK PLUG AND ABANDONMENT COMMENCE DRILLING OPNS. **CHANGE PLANS** TEMPORARILY ABANDON CASING TEST AND CEMENT JOB PULL OR ALTER CASING OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent date, including estimated date of starting any proposed work) SEE RULE 1103. OCO 334-6/72 Y/6 work) SEE RULE 1103. OCO 334-6/78 × 16 Elm Ridge Resources, Inc intends to plug and abandon this well in accordance with regulations. Production equipment will be removed. Plugs will be placed inside and outside casing unless evidence of cement behind pipe is indicated. Proposed procedure as follows: Notify-BLM office @ 505-599-8907 24-hrs prior to commencement of plugging operations. Pull all retrievable downhole equipment. Set a CIBP @ 5290'. Spot a 200' cement plug on top of CIBP @ 5090'. Set a 200' cement plug from 3350 to 350 across Mesa Verde inside and outside 4-1/2" casing. Set a 200 cement plug from 2050 to 1850 across Pictured Cliffs inside and outside 4-1/2" casing. Set a 100' cement plug from 1500 to 2005 Fruitland inside and outside 4-1/2 " casing. Set a 200' cement plug from 1300' to 1120' across Ojo Alamo inside and outside 4-1/2" casing. Set a 250° cement plug from 250° to surface between 8-5/8" and 4-1/2" casing. Cut off wellhead. Install dryhole markers. inside doutside CASing Clear and remediate. Certified Return Receipt # 7001 1940 0002 1375 7641 Beleke July 31, 2003 I hereby certify that the information above is the and complete to the best of my knowledge and belief. 03/17/03 **Production Technician** SIGNATURE TELEPHONE NO. 505-632-3476 dy Grubelnik TYPE OR PRINT NAME DEPUTY OIL & GAS INSPECTOR, DIST. & (This space for State Use) APPROVED BY DATE CONDITIONS OF APPROVAL, IF ANY: