Submit 3 Copies To Appropriate Distri	ict Stat	te of New Mexico		Form C-103
Office <u>District I</u>	Energy, Mine	erals and Natural Resources	S THE STATE OF THE	March 4, 2004
1625 N. French Dr., Hobbs, NM 88240 District II			WELL API NO. 30-045-30255	
1301 W. Grand Ave., Artesia, NM 882	210	SERVATION DIVISION	5. Indicate Type	of Lease
District III 1000 Rio Brazos Rd., Aztec, NM 8741	10	South St. Francis Dr.	STATE	
District IV	San	ta Fe, NM 87505	6. State Oil & G	as Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505				
	OTICES AND REPOR		7. Lease Name of	r Unit Agreement Name
(DO NOT USE THIS FORM FOR PR DIFFERENT RESERVOIR. USE "AI	OPOSALS TO DRILL OR TO PPLICATION FOR PERMIT"	'(FORMO 101) FOR SUCH	Allison Unit	
PROPOSALS.)			8. Well Number	
1. Type of Well: Oil Well	X Other	200g		
2. Name of Operator	AL Outer		9. OGRID Numl	200
Burlington Resources Oil &	Gas Company LP	Constitution of		ber
3. Address of Operator		18	10. Pool name or	r Wildcat
P.O. Box 4289, Farmington,	NM 87499-4289		Blanco Mesavero	le - 72319
4. Well Location		SIN ELCIA		
Unit Letter C	675 feet from t	the <u>North</u> line and	1 2655 feet from the	West line
Omi Letter	073 ICCI HOIII		1	west mic
Section 8			W NMPM San Juan	County
	11. Elevation (Sho	ow whether DR, RKB, RT, GR,	etc.)	
Pit or Below-grade Tank Application	(For nit or helow-grade tan	ik closures a form C-144 must be at	tached)	
Pit Location: ULSectT				earest fresh water well
1		nk Location ULSect	·	cuitest itesii water wen
feet from theline a			,	
12 Cha	ale Ammanmiata Dass	A. I. J A. NI. L CNI. A	! D 0.1	The same
		to Indicate Nature of Not	· •	
NOTICE OF	INTENTION TO:	S	UBSEQUENT RE	PORT OF:
	INTENTION TO:	S	· •	
NOTICE OF	INTENTION TO:	NDON REMEDIAL V	UBSEQUENT RE	PORT OF: ALTERING CASING PLUG AND
NOTICE OF PERFORM REMEDIAL WORK	FINTENTION TO:	NDON REMEDIAL V	SUBSEQUENT REVORK	PORT OF: ALTERING CASING
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON	FINTENTION TO: C PLUG AND ABAN CHANGE PLANS	NDON REMEDIAL V	SUBSEQUENT REVORK CONTROL C	PORT OF: ALTERING CASING PLUG AND
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING	FINTENTION TO: C PLUG AND ABAN CHANGE PLANS MULTIPLE	REMEDIAL V COMMENCE CASING TES CEMENT JO	SUBSEQUENT REVORK DRILLING OPNS. STAND B	PORT OF: ALTERING CASING PLUG AND ABANDONMENT
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER:	FINTENTION TO: PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION	S REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER:	SUBSEQUENT REVORK DRILLING OPNS. ST AND B Change TBG setting de	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth X
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or co	FINTENTION TO: PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION ompleted operations. (C	S REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER:	BUBSEQUENT REVORK DRILLING OPNS. BT AND B Change TBG setting depositions and give pertinent dates	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth X es, including estimated date
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or co	FINTENTION TO: PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION ompleted operations. (C	S REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER:	BUBSEQUENT REVORK DRILLING OPNS. BT AND B Change TBG setting depositions and give pertinent dates	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth X es, including estimated date
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or co of starting any proposed or recompletion.	FINTENTION TO: C PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION ompleted operations. (Cd work). SEE RULE 11	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail. 03. For Multiple Completions	BUBSEQUENT REVORK DRILLING OPNS. ST AND B Change TBG setting depositions, and give pertinent dates: Attach wellbore diagrams.	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth X es, including estimated date am of proposed completion
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or co of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remov	FINTENTION TO: C PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION completed operations. (Cd work). SEE RULE 11	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions	BUBSEQUENT REVORK DRILLING OPNS. ST AND B Change TBG setting depose, and give pertinent datase Attach wellbore diagram. ND WH. NU & test B	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth Coth Coth
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or constraint of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592	FINTENTION TO: PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION ompleted operations. (Od work). SEE RULE 11 re Horse head & unseat p. 2' (29' fill). TOOH & ir	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump Dispect 2-3/78" tubing (bottom)	BUBSEQUENT REVORK E DRILLING OPNS. ST AND B Change TBG setting depose, and give pertinent data: Attach wellbore diagram. ND WH. NU & test B its bad). TIH w/2-3/8	PORT OF: ALTERING CASING PLUG AND ABANDONMENT Oth Coth Coth
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or confession of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flucirc. Hole clean. TOOH w/tbg.	FINTENTION TO: CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION C	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom: D acid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556	EUBSEQUENT REVORK E DRILLING OPNS. Change TBG setting deposes, and give pertinent data: Attach wellbore diagram ND WH. NU & test B is jts bad). TIH w/2-3/8 is Let acid work 2.5 hrs w/SN @ 5516'. ND B	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth Toth Toth
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or constraining any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Floring proposed or constraining and proposed or recompletion.	FINTENTION TO: CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION C	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom: D acid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556	EUBSEQUENT REVORK E DRILLING OPNS. Change TBG setting deposes, and give pertinent data: Attach wellbore diagram ND WH. NU & test B is jts bad). TIH w/2-3/8 is Let acid work 2.5 hrs w/SN @ 5516'. ND B	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth Toth Toth
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or confession of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flucirc. Hole clean. TOOH w/tbg.	FINTENTION TO: CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION C	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom: D acid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556	EUBSEQUENT REVORK	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth Toth Toth
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or confession of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flucirc. Hole clean. TOOH w/tbg.	FINTENTION TO: CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION C	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom: D acid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556	EUBSEQUENT REVORK	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth Toth Toth
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or constraint of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flow Circ. Hole clean. TOOH w/tbg. equipment. RIH w/RWBC-Z put I hereby certify that the information.	PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION Ompleted operations. (Cd work). SEE RULE 11 The Horse head & unseat processing the processing of the proc	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom Dacid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556" ut. Hang horse head & load tb	BUBSEQUENT REWORK DRILLING OPNS. TAND B Change TBG setting delease, and give pertinent data: Attach wellbore diagram. ND WH. NU & test B 3 jts bad). TIH w/2-3/8 g. Let acid work 2.5 hrs w/SN @ 5516'. ND B g – test to 500# - OK. In the ledge and belief. I furtheledge and belief. I furtheledge and belief. I furtheledge and belief. I furtheledge and belief.	PORT OF: ALTERING CASING PLUG AND ABANDONMENT Oth X es, including estimated date am of proposed completion OP. – OK. Unseat tbg "tubing and acidize w/1000. RIH & circ. Acid out. OP, NU WH & RU rod RD & released rig 5/27/04.
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or constraint of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flucirc. Hole clean. TOOH w/tbg. equipment. RIH w/RWBC-Z put	PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION Ompleted operations. (Cd work). SEE RULE 11 The Horse head & unseat processing the processing of the proc	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom Dacid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556" ut. Hang horse head & load tb	BUBSEQUENT REWORK DRILLING OPNS. TAND B Change TBG setting delease, and give pertinent data: Attach wellbore diagram. ND WH. NU & test B 3 jts bad). TIH w/2-3/8 g. Let acid work 2.5 hrs w/SN @ 5516'. ND B g – test to 500# - OK. In the ledge and belief. I furtheledge and belief. I furtheledge and belief. I furtheledge and belief. I furtheledge and belief.	PORT OF: ALTERING CASING PLUG AND ABANDONMENT Oth X es, including estimated date am of proposed completion OP. – OK. Unseat tbg "tubing and acidize w/1000. RIH & circ. Acid out. OP, NU WH & RU rod RD & released rig 5/27/04.
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or constraint of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flow Circ. Hole clean. TOOH w/tbg. equipment. RIH w/RWBC-Z put I hereby certify that the information.	PLUG AND ABAN CHANGE PLANS MULTIPLE COMPLETION Ompleted operations. (Cd work). SEE RULE 11 The Horse head & unseat processing the processing of the proc	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom Dacid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556" ut. Hang horse head & load tb	EUBSEQUENT REVORK E DRILLING OPNS. Change TBG setting deposes, and give pertinent data: Attach wellbore diagram ND WH. NU & test B is jts bad). TIH w/2-3/8; Let acid work 2.5 hrs w/SN @ 5516'. ND B g — test to 500# - OK. Is ledge and belief. I furthalt or an (attached) alternation.	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth X es, including estimated date am of proposed completion OP. – OK. Unseat tbg tubing and acidize w/1000. RIH & circ. Acid out. OP, NU WH & RU rod RD & released rig 5/27/04. er certify that any pit or belowative OCD-approved plan
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or consistering any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flucirc. Hole clean. TOOH w/tbg. equipment. RIH w/RWBC-Z put I hereby certify that the information of the proposed or recompletion. I hereby certify that the information of the proposed or recompletion. I hereby certify that the information of the proposed or recompletion.	CHANGE PLANS CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION COM	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail. 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom: D acid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556; ut. Hang horse head & load tb complete to the best of my know tocd guidelines \(\Bar{\text{q}} \), a general perm TITLE \(\Sr. \) Regulatory Sy	BUBSEQUENT REVORK DRILLING OPNS. TAND B Change TBG setting depositions of the setting depositions o	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth X es, including estimated date am of proposed completion OP. – OK. Unseat tbg "tubing and acidize w/1000. RIH & circ. Acid out. OP, NU WH & RU rod RD & released rig 5/27/04. er certify that any pit or below- lative OCD-approved plan 6/29/04
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or consistering any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flucirc. Hole clean. TOOH w/tbg. equipment. RIH w/RWBC-Z put I hereby certify that the information of the proposed or recompletion. I hereby certify that the information of the proposed or recompletion. I hereby certify that the information of the proposed or recompletion.	CHANGE PLANS CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION CHANGE PLANS MULTIPLE COMPLETION CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION CHANGE PLANS CHANGE PLANS CHANGE PLANS CHANGE PLANS CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION CHANGE PLANS CHANGE PL	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom Dacid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556" ut. Hang horse head & load tb	BUBSEQUENT REVORK DRILLING OPNS. TAND B Change TBG setting depositions of the setting depositions o	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth X es, including estimated date am of proposed completion OP. – OK. Unseat tbg tubing and acidize w/1000. RIH & circ. Acid out. OP, NU WH & RU rod RD & released rig 5/27/04. er certify that any pit or belowative OCD-approved plan
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or construction of starting any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Fluctire. Hole clean. TOOH w/tbg. equipment. RIH w/RWBC-Z put I hereby certify that the informate grade tank has been/will be constructed. SIGNATURE Type or print name Pats:	CHANGE PLANS CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION COM	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom Dacid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556" ut. Hang horse head & load tb Implete to the best of my know MOCD guidelines Regulatory Sp mil address: pclugston@br-inc	BUBSEQUENT REMORK DRILLING OPNS. TAND Change TBG setting deposes, and give pertinent data and attach wellbore diagram. ND WH. NU & test B is jts bad). TIH w/2-3/8 is Let acid work 2.5 hrs w/SN @ 5516'. ND B g — test to 500# - OK. Is dedge and belief. I furthat or an (attached) alternated or an (attached) alternated or an (attached) alternated is come.	PORT OF: ALTERING CASING PLUG AND ABANDONMENT Oth X es, including estimated date am of proposed completion OP. – OK. Unseat tbg "tubing and acidize w/1000 RIH & circ. Acid out. OP, NU WH & RU rod RD & released rig 5/27/04. er certify that any pit or belowative OCD-approved plan 6/29/04 505-326-9518
NOTICE OF PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or consistering any proposed or recompletion. 5/24/04 MIRU TJR #2. Remove hanger & tagged bottom @ 5592 gal 15% Acid w/triple inhib. Flucirc. Hole clean. TOOH w/tbg. equipment. RIH w/RWBC-Z put I hereby certify that the information of the proposed or recompletion. I hereby certify that the information of the proposed or recompletion. I hereby certify that the information of the proposed or recompletion.	CHANGE PLANS CHANGE PLANS CHANGE PLANS MULTIPLE COMPLETION COM	REMEDIAL V COMMENCE CASING TES CEMENT JO OTHER: Clearly state all pertinent detail 03. For Multiple Completions Dump. TOOH w/rods & pump respect 2-3/78" tubing (bottom Dacid truck. TOOH w/tubing 2-3/8" tubing and set @ 5556" ut. Hang horse head & load tb Implete to the best of my know MOCD guidelines Regulatory Sp mil address: pclugston@br-inc	BUBSEQUENT REVORK DRILLING OPNS. TAND B Change TBG setting depositions of the setting depositions o	PORT OF: ALTERING CASING PLUG AND ABANDONMENT oth X es, including estimated date am of proposed completion OP. – OK. Unseat tbg "tubing and acidize w/1000. RIH & circ. Acid out. OP, NU WH & RU rod RD & released rig 5/27/04. er certify that any pit or below- lative OCD-approved plan 6/29/04