	Sundry Not	ices and Reports or	n Wells	/	
					se Number F-078741
. Type of Wel	1	TOO 1900¢	23 PM 2 02	6. If	Indian, All. or be Name
				7. Uni	t Agreement Name
. Name of Ope		·	RECEIVED ARMINGTOILIM	, . OIII	o ngreement name
BURLING			7441111111 C 1 W 1 1 1 1 1 1 1 1 1 1 1 1 1		
RESOU	RCES OIL & GAS	COMPANY LP	A STATE OF THE STA		Juan 30-6 Unit
Address & E	hone No. of Opera	tor			l Name & Number Juan 30-6 U #490s
		. 87499 (505) 326 √ 9	9700 12 1	3 X	Well No.
	<u> </u>	<u>fr</u>	10/2	ું∫ 30−	039-27719
	Well, Footage, S		TOO TOO	~ 7	ld and Pool
920'FSL, 14	95' FEL, Sec.25, T	-30-N, R-6-W, NMPM			in Fruitland Coal
			2 Company	**/	Arriba Co, NM
				J	
		DICATE NATURE OF NO		OTHER DATA	1
Type of Sub	mission ice of Intent	Type (Abandonment	of Action	of Dlama	•
NOU	ice of intent	Recompletion		of Plans struction	
X Sub	sequent Report	Plugging Back	k Non-Rou	tine Fract	curing
		Casing Repair			
Fir	al Abandonment	X Other - Comp	ing Convers	ion to in	jection
		n other comp.	1001011		
B. Describe	Proposed or Comp	leted Operations			·····
		BOP. PT BOP & 7" c	sq to 1500 psi/	30 min, O	K. SDON.
9-23-04	MIRU. ND WH. NU				
9-23-04 9-24-04		o TOC @ 3336'. Dri			
9-24-04	TIH w/6 $\frac{1}{4}$ " bit t from 3400' to	TD @ 3722'. Circ ho	ole clean. SDON	•	a 1
9-24-04 9-25-04	TIH w/6 ¼" bit t from 3400' to ' Circ hole clean.	TD @ 3722'. Circ ho TOOH w/bit. TIH w	ole clean. SDON /9 ½″ underream	•	c Sunday.
9-24-04 9-25-04 9-27-04	TIH w/6 ¼" bit t from 3400' to Circ hole clean. Establish circ.	TD @ 3722'. Circ ho TOOH w/bit. TIH w Underream @ 3410-3	ole clean. SDON /9 ½″ underream 612′. SDON.	er. SD fo	_
9-24-04 9-25-04 9-27-04 9-28-04	TIH w/6 4" bit t from 3400' to ' Circ hole clean. Establish circ. Underream @ 3612	TD @ 3722'. Circ ho TOOH w/bit. TIH w	ole clean. SDON /9 ½" underream 612'. SDON. clean. TOOH w/u	er. SD fo	_
9-24-04 9-25-04 9-27-04	TIH w/6 ¼" bit to from 3400' to Circ hole clean. Establish circ. Underream @ 3612 TIH, ran logs. TBlow well & CO.	TD @ 3722'. Circ ho TOOH w/bit. TIH w, Underream @ 3410-30 2-3722'. Circ hole o COOH. TIH, blow wel. TOOH. TIH w/11 jts	ole clean. SDON /9 ½" underream 612'. SDON. clean. TOOH w/u l & CO. SDON. 5 ½" 15.5# K-5	er. SD fo: nderreame: 5 ST&C ln:	r, set @ 3722'.
9-24-04 9-25-04 9-27-04 9-28-04 9-29-04	TIH w/6 ¼" bit to from 3400' to Circ hole clean. Establish circ. Underream @ 3612 TIH, ran logs. TBlow well & CO. Top of lnr @ 3	TD @ 3722'. Circ ho TOOH w/bit. TIH w, Underream @ 3410-36 -3722'. Circ hole o OOH. TIH, blow wel. TOOH. TIH w/11 jts 360'. TIH w/perf m	ole clean. SDON /9 ½" underream 612'. SDON. clean. TOOH w/u 1 & CO. SDON. 5 ½" 15.5# K-5 ill. Mill perf	er. SD fo: nderreame: 5 ST&C ln:	r, set @ 3722'.
9-24-04 9-25-04 9-27-04 9-28-04 9-29-04 9-30-04	TIH w/6 ¼" bit to from 3400' to conclude the clean. Establish circ. Underream @ 3612 TIH, ran logs. Top of lnr @ 3 TOOH w/mill. C	TD @ 3722'. Circ ho TOOH w/bit. TIH w, Underream @ 3410-36 -3722'. Circ hole o OOH. TIH, blow wel. TOOH. TIH w/11 jts 360'. TIH w/perf modern hole clean. SDO	ole clean. SDON /9 ½" underream 612'. SDON. clean. TOOH w/u 1 & CO. SDON. 5 ½" 15.5# K-5 ill. Mill perf	er. SD fo: nderreame: 5 ST&C ln. plugs @ 34	r, set @ 3722'.
9-24-04 9-25-04 9-27-04 9-28-04 9-29-04	TIH w/6 ¼" bit to from 3400' to control of the clean. Establish circ. Underream @ 3612 TIH, ran logs. Top of lnr @ 3 TOOH w/mill. Control of the control of	TD @ 3722'. Circ ho TOOH w/bit. TIH w, Underream @ 3410-30 -3722'. Circ hole o OOH. TIH, blow wel. TOOH. TIH w/11 jts 360'. TIH w/perf mi irc hole clean. SDC 3/8" 4.7# J-55 EUE	ole clean. SDON /9 ½" underream 612'. SDON. clean. TOOH w/u 1 & CO. SDON. 5 ½" 15.5# K-5 ill. Mill perf DN. tbg, landed @	er. SD for nderreamer 15 ST&C ln. plugs @ 34	r, set @ 3722'. 127-3545'.
9-24-04 9-25-04 9-27-04 9-28-04 9-29-04 9-30-04	TIH w/6 ¼" bit to from 3400' to control of the clean. Establish circ. Underream @ 3612 TIH, ran logs. Top of lnr @ 3 TOOH w/mill. CTIH w/114 jts 2 ND BOP. NU WH.	TD @ 3722'. Circ ho TOOH w/bit. TIH w, Underream @ 3410-36 -3722'. Circ hole o OOH. TIH, blow wel. TOOH. TIH w/11 jts 360'. TIH w/perf modern hole clean. SDO	ole clean. SDON /9 ½" underream 612'. SDON. clean. TOOH w/u 1 & CO. SDON. 5 ½" 15.5# K-5 ill. Mill perf DN. tbg, landed @ & pump. Load t	er. SD for nderreamer 15 ST&C ln. plugs @ 34	r, set @ 3722'. 127-3545'.
9-24-04 9-25-04 9-27-04 9-28-04 9-29-04 9-30-04	TIH w/6 ¼" bit to from 3400' to control of the clean. Establish circ. Underream @ 3612 TIH, ran logs. Top of lnr @ 3 TOOH w/mill. CTIH w/114 jts 2 ND BOP. NU WH.	TD @ 3722'. Circ ho TOOH w/bit. TIH w, Underream @ 3410-36 2-3722'. Circ hole @ OOH. TIH, blow wel. TOOH. TIH w/11 jts 360'. TIH w/perf mi irc hole clean. SDC 3/8" 4.7# J-55 EUE TIH w/131 ¾" rods	ole clean. SDON /9 ½" underream 612'. SDON. clean. TOOH w/u 1 & CO. SDON. 5 ½" 15.5# K-5 ill. Mill perf DN. tbg, landed @ & pump. Load t	er. SD for nderreamer 15 ST&C ln. plugs @ 34	r, set @ 3722'. 127-3545'.
9-24-04 9-25-04 9-27-04 9-28-04 9-29-04 9-30-04	TIH w/6 ¼" bit to from 3400' to control of the clean. Establish circ. Underream @ 3612 TIH, ran logs. Top of lnr @ 3 TOOH w/mill. CTIH w/114 jts 2 ND BOP. NU WH.	TD @ 3722'. Circ ho TOOH w/bit. TIH w, Underream @ 3410-36 2-3722'. Circ hole @ OOH. TIH, blow wel. TOOH. TIH w/11 jts 360'. TIH w/perf mi irc hole clean. SDC 3/8" 4.7# J-55 EUE TIH w/131 ¾" rods	ole clean. SDON /9 ½" underream 612'. SDON. clean. TOOH w/u 1 & CO. SDON. 5 ½" 15.5# K-5 ill. Mill perf DN. tbg, landed @ & pump. Load t	er. SD for nderreamer 15 ST&C ln. plugs @ 34	r, set @ 3722'. 127-3545'.

14. I hereby certify that the signed ancy Oltmann			_Date	ACCEPTED FOR RECOR
(This space for Federal or State APPROVED BY	Office use) Title	Date		OET 2 0 2004
CONDITION OF APPROVAL, if any:				FAMININGTON FIELD OFFICE BY

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.