Form 3160-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB NO. 1004-0135
Expires: November 30, 200

5.	e Serial No.

- 1	Э.	Lease	,
ı		JIQ 104	
		0,00 .0.	

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an

If Indian. Allottee or Tribe Name

abandoned we	II. Use form 3160-3 (APL)) for such p	roposals.	i		1 o. 11 monan, ranonec	or Tribe tvante		
SUBMIT IN TRIPLICATE - Other instructions on reverse side.					7. If Unit or CA/Agr	eement, Name and/o	or No.		
I. Type of Well ☐ Oil Well ☑ Gas Well ☐ Other				42526	· ·	8. Well Name and No. JICARILLA E 15A			
2. Name of Operator CONOCO PHILLIPS Contact: DEBORAHATE E-Mail: debox				Y @congco	phillips.cor	9. API Well No. 30-039-26911			
3a. Address P.O. BOX 2197 WL3 6108 HOUSTON, TX 77252 3b. Phote Ro Ph: 832-48				1 code)	103117	10. Field and Pool, or Exploratory BLANCO MV/TAPACITO PC			
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)	15	NOV.	5.00	N/	11. County or Parish	, and State		
Sec 16 T26N R4W NESW 162	20FSL 1960FWL			019		RIO ARRIBA (COUNTY, NM		
12. CHECK APPR	ROPRIATE BOX(ES) TO	INDICATE	NATURE	OF NO	TICE, R	EPORT, OR OTH	ER DATA		
TYPE OF SUBMISSION			TY	PE OF A	ACTION				
☐ Notice of Intent	☐ Acidize	□ Dee _l	en		☐ Production (Start/Resume)		☐ Water Shut	t-Off	
	☐ Alter Casing	☐ Frac	ture Treat		□ Reclam	ation	Well Integr	rity	
Subsequent Report	☐ Casing Repair	□ New	Construction	on	□ Recomple	plete	□ Other		
☐ Final Abandonment Notice	Change Plans	🛛 Plug	and Aband	lon	□ Tempor	rarily Abandon			
	☐ Convert to Injection	Plug	☐ Plug Back		■ Water Disposal				
following completion of the involved testing has been completed. Final Abdetermined that the site is ready for fi	pandonment Notices shall be file inal inspection.)	d only after all i	equirements,	, including	g reclamatio	n, have been completed RECEIVED RECTON	and the operator ha	ıs	
14. I hereby certify that the foregoing is	Electronic Submission #2	28779 verified CO PHILLIPS	by the BLM sent to the			System			
Name(Printed/Typed) DEBORAL	H MARBERRY		Title SI	JBMITT	ING CON	TACT			
Signature (Electronic S	Submission)		Date 03	3/11/200	4				
THIS SPACE FOR FEDERAL OR STATE OFFICE USE									
Approved By			Title				Date		
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office						
Title 18 U.S.C. Section 1001 and Title 43	U.S.C. Section 1212, make it a c	crime for any pe	son knowing	gly and wi	llfully to ma	ake tACCEPTED FO	inempy of the Unite	ed	

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **

A-PLUS WELL SERVICE, INC.

P.O. BOX 1979

Farmington, New Mexico 87499 505-325-2627 * fax: 505-325-1211

ConocoPhillips Co.

January 15, 2004 Page 1 of 1

Jicarilla E 15A

1620' FSL & 1960' FWL, Section 16, T-26-N, R-4-W

Plug & Abandonment Report

Rio Arriba County, NM

Lease: Jic Contract #104, API #30-039-26911

Cementing Summary:

Plug #1 with existing CIBP at 2950'; spot 24 sxs cement inside 4-1/2" casing above BP up to 2634' to isolate the Ojo Alamo top.

Plug #2 with 16 sxs cement inside 4-1/2" casing from 1108' to 897' to cover the Nacimiento top.

Plug #3 with 16 sxs cement inside 4-1/2" casing from 565' to 354' to cover the 9-5/8" casing shoe.

Plug #4 with 45 sxs cement pumped down the 4-1/2" casing from 100' to surface, circulate good cement out bradenhead.

Plug and Abandonment Summary:

Notified JAT

- 1/08/04 MOL. Check LEL around wellhead. Held JSA. RU. Line and fence pit. No well pressure. Casing is flowing water. SDFD.
- 1/09/04 Held JSA. Layout relief lines to pit. Note: casing still flowing water. Shut in and hook up blow down lines. ND wellhead. NU BOP and test. PU 1-1/4" tubing workstring and TIH; tag existing CIBP at 2950'. Circulate well clean with 50 bbls of water. Attempt to pressure test casing, leak 1 bpm at 350#. Plug #1 with existing CIBP at 2950'; spot 24 sxs cement inside 4-1/2" casing above BP up to 2634' to isolate the Ojo Alamo top. TOH and WOC. SDFD.
- 1/12/04 Held JSA. TIH with tubing and tag cement at 2636'. Pressure test casing to 500# for 5 minutes. PUH to 1108'. Plug #2 with 16 sxs cement inside 4-1/2" casing from 1108' to 897' to cover the Nacimiento top. PUH to 565'. Plug #3 with 16 sxs cement inside 4-1/2" casing from 565' to 354' to cover the 9-5/8" casing shoe. TOH and LD tubing. RD floor and dig out cellar in preparation to cut off wellhead. RU A-Plus wireline truck and perforate 3 squeeze holes at 100'. Establish circulation with 2 bbls of water and circulate clean with total of 10 bbls of water. Plug #4 with 45 sxs cement pumped down the 4-1/2" casing from 100' to surface, circulate good cement out bradenhead. Shut in well and WOC. SDFD.
- 1/13/04 Held JSA. Open up well. Tag cement at 12' in 4-1/2" casing and at surface in annulus. Cut off wellhead. Mix 22 sxs cement, top off 4-1/2" casing and install P&A marker. RD and MOL.

No JAT representative was on location.